## **CERTIFIED CORNER RECORDATION**

Corner C 1/4 Sec. 10 T. 31N R. 31W P.M., MT Lincoln County

I. <u>1981 Certificate of Survey #951 filed in Lincoln County Courthouse by M. D. Lauteren #4232-S</u>: Set a 5/8 in. x 24 in. rebar with plastic cap.

1986 Corner Recordation filed in Lincoln County Courthouse by Thomas C. Hill #5612-S: At the determined corner position, found a 5/8 in. diam. steel rebar, protruding 1 in. above ground, with a 1 1/4 in. plastic cap mkd. "MDL 4232 S". Referenced by the following unrecorded references:

A pine, 9 ins. diam., bears N 47°E, 32.2 ft. dist, visible marks: C 1/4 S10. A pine, 12 ins. diam., bears N 36°W, 39.6 ft. dist., visible marks: C 1/4 S10

Set a guard post, with a "Survey Marker" decal attached, 1 ft. South from corner.

II. Found a 5/8 in.diam. steel rebar, 1 in. above ground, firmly set, with a 1 1/4 in. plastic cap mkd. as shown:



from which unrecorded bearing trees:


A stump, 10 ins. diam., bears N 47°E, 32.3 ft. dist, with visible scribing. A fallen pine stump, bears N 36°W, 39.6 ft. dist., with visible scribing.

III. Established two new bearing trees:

A fir, 12 ins. diam., bears S10°E, 36.1 ft. dist., mkd. "C 1/4 S10 BT". A larch, 10 ins. diam., bears S65°E, 64.5 ft. dist., mkd. "C 1/4 S10 BT".

Painted red bands around the bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East

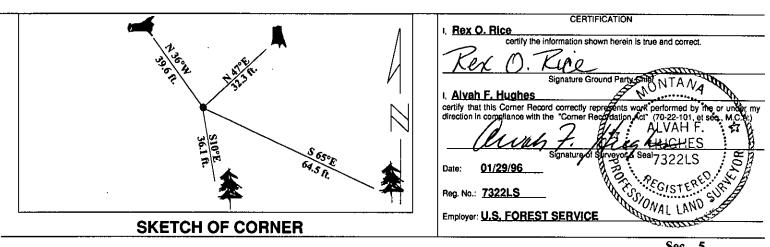

ross Index No. G-15

<sup>T.</sup> 31N <sup>R.</sup> 31W <sup>PMI</sup>