INSTRUCTIONS

- Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated
- 3. Description of monument and accessories set to perpetuate the corner position.
- Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
 Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.


CERTIFIED CORNER RECORDATION

T. 31 N., R. 33 W., P.M.M. S.W. of Sec. 4 Corner . 1893 G.L.O. original record by D. P. MUMBRUE: Set a post 4 ft. long, 4 ins. square, 24 ins. in the ground, for Cor. to Secs. 4,5,8 & 9, marked: T31N S4 on N.E. R33W S9 on S.E. S 8 on S.W. AND S 5 on N.W. faces, with 5 notches on SOUTH, and 4 notches on EAST edges. from which:

A pine, 12 ins. diam., bears N 37 $1/2^{\circ}$ E, 22 lks., dist., mkd. T31N R33W S4 BT. A hemlock, 14 ins. diam., bears S 50 $3/4^{\circ}$ E, 58 lks., dist., mkd. T31N R33W S9 BT. A hemlock, 12 ins. diam., bears S 23 1/2 W, 51 lks., dist., mkd. T31N R33W S8 BT. A hemlock, 10 ins. diam., bears N 24 $1/2^{\circ}$ W, 30 lks., dist., mkd. T31N R33W S5 BT.

II. Found a 3/4 in. diam. iron pipe, 10 ins. above ground, loosely set. (No record.) No bearing trees found.

III. At the position determined by survey, set a 2 1/2 in. diam., 30 in. long aluminum pipe, 26 ins. in the ground, with a 3 1/4 in. U.S.D.A. Forest Service aluminum cap mkd. as shown:



Established 4 new bearing trees:


A larch, 8 ins. diam., bears N12 $^{\circ}$ E, 29.4 ft., dist., mkd. T31N R33W S4 BT.

A larch, 12 ins. diam., bears S63 E, 13.9 ft., dist., mkd. T31N R33W S9 BT. A larch, 17 ins. diam., bears S74 W, 54.3 ft., dist., mkd. T31N R33W S8 BT.

A larch, 11 ins. diam., bears N2 W, 42.3 ft., dist., mkd. T31N R33W S5 BT.

Painted a red band around bearing trees and attached Land Survey Monument and Bearing Tree signs.

Set a 6 ft. galvanized steel guard post with Land Survey Marker and Property Bounday decals, NORTH, 3 feet. Magnetic Declination: 20 East.

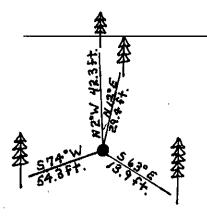

SKETCH OF CORNER

CERTIFICATION M. Hommel طرcertify the

Alvah F. Hughes certify that this Corner Record correctly rep

12/21/93 Reg. No.

U.S. FOREST SERVICE

Sec.

. This "corner Office of Clerk and Recorder, County of A record" was filed for record on _ was noted on the cross-index plat and is assigned page No. book No. _

Cross Index No. -

umm County Officia

33 W

· - corner this sheet