
CERTIFIED CORNER RECORDATION

Corner 1/4 Secs. 22&27 T. 31N R. 34W P.M., MT Lincoln County

I. 1903 G.L.O. Original Record by Allen B. Benedict: Set a pine post, 3 ft. long, 4 ins. square, 24 ins. in the ground, for 1/4 sec. cor., mkd. "1/4 S22" on the North and "27" on the South faces. Established two bearing trees.

1984 USFS Certified Corner Recordation by Thomas C. Hill, 5612S: Found the remains of a post and vertical hole, 20 ins. deep, witnessed by the remains of one of the original bearing trees, and a mound of earth, South of corner. At the corner point, set a 2 1/2 in. diam. aluminum post, 30 ins. long, 24 ins. in the ground, with a USFS, aluminum cap mkd. as shown.

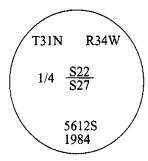

Established two new bearing trees and set a 6 ft. galvanized steel post.

II. Found a 2 1/2 in. diam. aluminum pipe, protruding 5 ins. above the ground, with a 3 1/4 in. diam. USFS aluminum cap, mkd. as shown.

from which:

A stump, with down log, 8 ins. diam., bears S61°E, 24.6 ft. dist., mkd. "1/4 S27 BT". (1984-rec)

A larch, 13 ins. diam., bears N05°W, 17.5 ft. dist., mkd. "1/4 S22 BT". (1984-record)

A galvanized steel post, North, 1.5 ft. dist. with a Land Survey Monument decal attached.

III. Established one bearing tree:

A cedar, 13 ins. diam., bears S70°E, 9.5 ft. dist., mkd. "1/4 S27 BT".

Painted red bands around the bearing tree and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East.

