- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories.
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

W 1/16 Sec Corner

Corner: Sections 1 &36

١

T. 31& 32 N. R. 34W. P.M.M. <u>Lincoln</u> County

1986 Record:

Set USDA Alum. cap and pipe 3-1/4 ins. dia. x 30 ins. long

(Davis 4975S) From which:

Red fir, 10 ins. dia, bears N62°W, 101 ft., scribed "W1/16 S36 BT", notched at

root crown, painted red band & attached BT sign.

Black pine, 18 ins. dia., bears S36°W, 20.4 ft., scribed W1/16 S1 BT", notched at

root crown, painted red band & attached BT sign

1994 Record: (Hughes 7322 LS) Found a 2-1/2 in. dia. alum. pipe, 6 ins. above the ground, firmly set in a collar of stone

w/ 3-1/4 ins. dia. USDA alum. cap.

From which:

Pine, 20 ins. dia., bears S20°W, 20.6 ft. w/ "6" visible (1986 Record S36°W) Fir, 10 ins. dia., bears N75°W, 101 ft., w/ "BT" visible (1986 Record N62°W)

2010 Found:

We find a 3-1/4 ins. dia. USDA alum. cap on 2-1/2 ins. dia. alum. pipe, as shown below,

rising 0.1 ft. from the ground.

From which:

Ponderosa Pine, 23 ins. dia., bears S23°W, 20.6 ft. w/ overgrown blaze & BT tag Douglas Fir, 10 ins. dia., bears N75°30' W, 101 ft., w/ overgrown blaze & BT tag

Steel fence post, bent & loose, bears West, 2.0 ft., w/ survey decals


2010 Perpetuation:

We establish no new reference monuments.

We set a galvanized steel post, West, 2.35 ft. from the monument w/ LSM and USFS

boundary decals.

Bearing trees were affixed with BT tags, snow blazed and a painted red band.

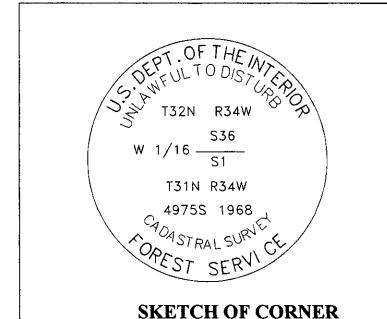

**CERTIFICATION** Keith Brandt certify the information shown herein is true and correct. \*\*\*\*\*\*\* I, Ken E Jenkins Corner Record correctly represents work performed by the of under my direction in compliance with the localized E. Recordation Act" (70-22/101 et led WICSA.) 93. ٤ Signature of Surveyor & Seal Reg. No. 9330 LS Date: 12/2010 Employer: Montana Northwest Company PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Office of Clerk and Recorder, County of This "corner 231793 BOOK: CCR CCER'S PAGE: 11762 Pages: 1 record" was filed for record of state of montana lincoln county RECORDED: 03/30/2011 11:13 KOI: CC4R'S was noted on the cross-index TAMMY D. LAUER CLERK AND RECORDER FEE: \$0.00 Le anni BY: Gensu book No. TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANÁ

| Sec. 1 |  |  |  |
|--------|--|--|--|
|        |  |  |  |
|        |  |  |  |
|        |  |  |  |
|        |  |  |  |