

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner W 1/4 Cor. Sec. 24 T. 31 N. R. 34 W. P.M.M. Lincoln County

- I. 1903 Original Survey by Allen B. Benedict et. al: "Set a limestone, 16x12x4 ins., 11 ins. in the ground, for 1/4 sec. cor. marked 1/4 on W face, from which

A fir, 8 ins. dia., bears N5°45'E, 155 lks. dist., marked 1/4 S24 BT.
A pine, 12 ins. dia., bears N3°30'W, 153 lks. dist., marked 1/4 S23 BT.

1982 Certified Corner Recordation by Melvin D. Lauteren, Reg. #4232S: "Evidence found: Original BTs, a pine, 20 ins. dia., and a fir, 12 ins. dia., no evidence of original stone. I re-establish the position of the 1/4 corner as per the sketch herewith. At the true position of the 1/4 corner I set a 2 1/2 ins. dia. x 28 ins. long aluminum pipe with cap marked as shown below:

T31N R34W
1/4
S23 | S24
MDL 4232-S
1981

from which

A fir, 12 ins. dia., bears N5°51'56"E, 103.52 ft. (157 lks./rcd: 155 lks.), overgrown blaze.
A pine, 12 ins. dia., bears N3°50'12"W, 100.3 ft. (152 lks./rcd: 153 lks.), overgrown blaze."


- II. Found a 2 1/2 ins. dia. aluminum pipe, 12 ins. above ground with 3 1/4 ins. dia., U.S.D.A., Forest Service, aluminum cap marked as shown above, from which

A fir, 16 ins. dia., bears N6°E, 103.52 ft. (157 lks./rcd: 155 lks.), overgrown blaze.
A ponderosa pine, 24 ins. dia., bears N3°W, 100.3 ft. (152 lks./rcd: 153 lks.), overgrown blaze."

- III. Painted red bands around the bearing trees and attached Land Survey Monument and Bearing Tree Signs.

Set a 6 ft. galvanized steel guard post with Land Survey Marker decal, North, 3.0 ft.

Magnetic Declination 20° East

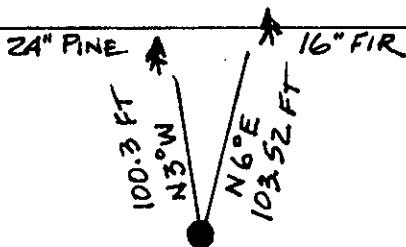

SKETCH OF CORNER

CERTIFICATION

I, Thomas M. Hommel

certify the information shown herein is true and correct.

Thomas M. Hommel
Signature Ground Party Chief

I, Alvah F. Hughes

certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Alvah F. Hughes
Signature of Surveyor & Seal

Date: 1/10/92 Reg. No. 7322S

Employer: U.S. FOREST SERVICE

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on 4-21-92 was noted on the cross-index plat and is assigned page No. 5044, in book No. Coral M. ...


County Official [Signature]

P-21

31 N 34 W

Cross Index No. _____ T. _____ R. _____ PMM

Sec. 24

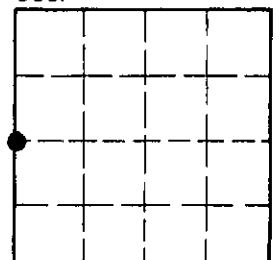

• - corner this sheet