

- INSTRUCTIONS
1. Original and/or subsequent record used to evaluate the corner position.
 2. Description of evidence found, and, note discrepancies in the record, state method of establishing lost or obliterated corners.
 3. Description of monument and accessories set to perpetuate the corner position.
 4. Sketch or corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
 5. Certification must be signed and sealed by Registered Land Surveyor in State of Montana.
 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner Cor. 2 H.E.S. 335 T. 33 N. R. 25 W. P.M.M. LINCOLN County

ORIGINAL RECORD U.S.D.A. 1915

Set for Cor. No. 2, a slate stone, 24x12x7 ins., 14 ins. in the ground, marked 2 H.E.S. on S.E. face, and a cross (x) on top for the exact corner point, from which:
A cross (x) on a fir tree, 7 ins. dia., bears N 22° 40' W, 2 lks. dist.
A cross (x) on a larch tree, 18 ins. dia., bears S 4° 50' W, 71 lks. dist.
Each blazed and scribed 2 HES 335 BT. Raise a mound of earth, 4 ft. base, 2 ft. high, SE of Cor.

B.L.M. REMONUMENTATION 1960

Cor. No. 2 of H.E.S. 335, monumented with a slate stone, 24x12x7 ins., set and marked as described in the official record. From which the original bearing trees:
A fir, 14 ins. dia., bears N 22° 40' W, 2 lks. dist., (record), mkd. as described in the official record.
A larch, 20 ins. dia., bears S 4° 50' W, 71 lks. dist., (record), mkd. as described in the official record.
At the corner point, set an iron post, 30 ins. long, 2 1/2 ins. dia., 26 ins. in the ground, in concrete, with brass cap mkd.

1960

T33N from which

S1	2 HES	A fir, 8 ins. dia., bears S 3 3/4° W, 44 lks. dist., mkd. 2 HES 335 BT.
R26W	335	
	S6	Bury the original stone alongside the iron post.
	R25W	

Raise a mound of stone, 3 ft. base, 2 1/2 ft. high, S.E. of the iron post.

EVIDENCE FOUND


Found a BLM brass cap, mkd.—as shown below, from which:
A fir, 18 ins. dia., bears N 22° 40' W, 1.4 ft. dist., mkd. with an overgrown blaze. (1915 BT)
A larch, 22 ins. dia., bears S 4° 50' W, 46.8 ft. dist., mkd. with an overgrown blaze. (1915 BT)
A fir, 12 ins. dia., bears S 3° 45' W, 29.1 ft. dist., mkd. with an overgrown blaze. (1960 BT)
A mound of stone S.E. of the brass cap.

CORNER PERPERUATION

Set a galvanized steel post with a Survey Marker decal and a Property Boundary decal, 3 ft. East of the brass cap. Painted red bands around the bearing trees and painted the scribing and blazing. Attached Bearing Tree signs and Land Survey Monument signs.

T33N
R26W R25W
S6
2
S1. HES
335
1960

ACTUAL MARKINGS ON BRASS CAP

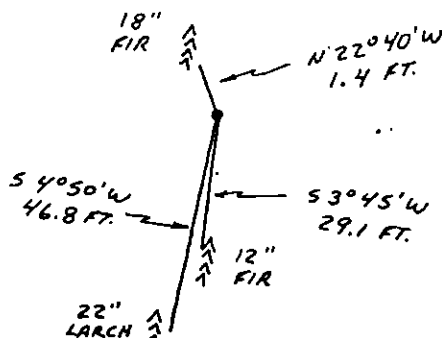

DECL. 21° E SKETCH OF CORNER

CERTIFICATION

I, _____
certify the information shown herein is true and correct.

Signature Ground Party Chief

Philip A. Helps

I, _____
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (78-2-101, et seq., M.C.A.)

Signature of Surveyor & Seal

Date: 10/87 Reg. No. 4739 S


Employer: F & H Land Surveying, Whitefish

Office of Clerk and Recorder, County of LINCOLN. This "corner record" was filed for record on the Nov 30 day of 1987, was noted on the cross-index plat and is assigned page No. 3762, in book No. _____

County Official

Cross Index No. 2-HES 335 T. 33 N. R. 25 W. P.M.M.

Sec. 6

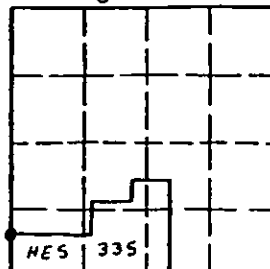

• corner this sheet