

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner $\frac{1}{4}$ Cor. Sec. 17 T. 32N R. 30W P.M.M. Lincoln County

Original GLO Notes: Set a limestone 20x8x6 in., 13" in the ground for $\frac{1}{4}$ Sec. Cor., mkd. $\frac{1}{4}$ on the W. face from which:

A fir 12" dia. bears E. 20 lks, mkd. $\frac{1}{4}$ S16 BT.

A fir 10" dia. bears N10 $\frac{1}{2}$ °W 27 lks, mkd. $\frac{1}{4}$ S17 BT.

(1916 by: Mans H. Coffin, Jr., R. Fitzhugh Maclean, & James R. Cumming)

1940 Dependent Resurvey: Fd a slate stone 20x8x6 in., mkd. & witnessed as described in the official record.

Corner for Sec. 17 only, erased marks on East BT...

Set an iron post, 3' long, 1" dia., 28" in ground for $\frac{1}{4}$ Sec. Cor., Sec. 17 at stone found for Sec. 17 only w/ stone set flush w/ surface on W. side of post, w/ brass cap mkd: T32N R30W By: Ranney Y. Lyman, Cadastral Engineer)

S17

1940

A fir 18" dia bears S62°W 38 lks, mkd. $\frac{1}{4}$ S17 BT.

(A similar post falls North 27.7'± for $\frac{1}{4}$ cor. Sec. 16)

Found a 2 $\frac{1}{2}$ " GLO Brass cap on iron post in rock cairn (Mon. leans West) with cap mkd: T32N R30W A similar Mon. falls 25'± N. for Sec. 16.

S17
1940


Found BT's: 14" fir N3°W 16.3', Blaze healed.

14" fir S87°E 13.6', " " "

20" fir S64°W 25.0', " " "

Reconstructed rock cairn to 3' dia & cleared ground to 6' dia. Signed and painted BT's to meet USFS Specs. Set sign post near corner to S.

Decl. assumed 20°E.

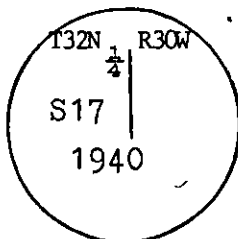

SKETCH OF CORNER (SEE ABOVE)

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Nov 16, 1987

was noted on the cross-index plat and is assigned page No. 3705, in

book No. _____

Cross Index No. L9 T. 32N R. 30W PMM

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

CERTIFICATION

~~Robert E. Findorff~~

certify the information shown herein is true and correct.

Signature Ground Party Chief

Robert E. Findorff


certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-2-101, et seq., M.C.A.)

Signature of Surveyor & Seal

Date: 9/12/87 Reg. No. 3976E8

Employer: Self

Sec. 17, T32N, R30W

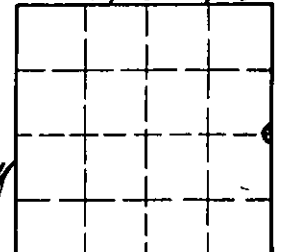

• corner this sheet

8719