

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner Sec. Cor.-Sec. 8 & 17 T. 32N R. 30W P.M.M. Lincoln County

Original GLO Notes: Set a limestone 16x10x8 in., 10" in the ground for Cor. to Sec. 8, 9, 16, & 17, mkd. w/4 notches on S. & E. edges from which:

A tamarack 14" bears N59 $\frac{1}{2}$ ° E 155 lks. mkd. T32N R30W S9 BT.

A fir 18" bears S33 $\frac{1}{2}$ ° E 125 lks. mkd. T32N R30W S16 BT.

A tamarack 24" bears S28 $\frac{1}{2}$ ° W 55 lks. mkd. T32N R30W S17 BT.

A fir 18" bears N69° W 104 lks. mkd. T32N R30W S8 BT.

(1916 by: Mans H. Ciffin, Jr., R. Fitzhugh Maclean, James R. Cumming)

1940 Dependent Resurvey: Found a slate stone 16x10x8 in. mkd and witnessed as described in the official record. Corner now refers to Sec. 8 & 17 only. I erased marks from E. bearing trees.

Set an iron post 3' long, 2" dia, 28" in ground for cor. Sec. 8 & 17 w/ stone set flush w/ surface on W. side of post, w/ brass cap mkd: T32N R30W
(By: Ranney Y. Lyman, Cadastral Engineer)

S8
S17 | S16

1940

Found 2 $\frac{1}{2}$ " brass cap on iron mon. in rock cairn. Post leans west and mkd:

Existing BT's: 33" fir N66° W 68.9', blaze & scribe overgrown. T32N R30W
30" Tam. S28° W 36.0', " " " " " "

New BT's: 10" tamarack N47° E 9.7' mkd. T32N R30W S16 BT.


8" fir S25° E 16.2' mkd. T32N R30W S16 BT.

All BT's signed and painted as per USFS Specs. Rebuilt rock cairn to specs. & cleared ground to 6' dia. around corner mon. Set sign post near corner.

S8
S17 | S16

1940

Decl. assumed 20°E.

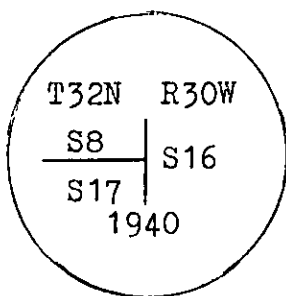

SKETCH OF CORNER (SEE ABOVE)

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on Nov 16, 1987

was noted on the cross-index plat and is assigned page No. 3707, in


book No. _____

Grant B. Suppley
County Official Deputy

Cross Index No. J9 T. 32N R. 30W P.M.M.

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

Sec. 8, T32N, R30W

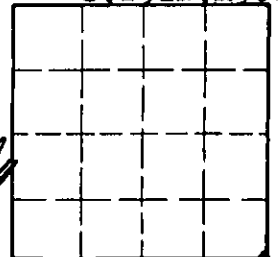

• corner this sheet

8719

CERTIFICATION

I, Dennis D. Findorff

certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Robert E. Findorff

certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101 et seq., M.C.A.)

Robert E. Findorff
Signature of Surveyor & Seal

Date: 9/12/87 Reg. No. 3976ES

Employer: Self