

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: 1/4 Corner; Sections 7 & 12 T. 32N. R. 33 & 34W. P.M.M. Lincoln County

1903 GLO Record: Set limestone and established 2 bearing trees.

1982 Record:
(Hill 5612S)

Found original stone lying loose on top of the ground. No evidence of original bearing trees was found. At determined proportional position, set a 2-1/2 ins. dia. x 30 ins. alum. pipe, 24 ins. in the ground w/ an alum. cap., in a collar of stone. Buried original stone alongside. (NOTE: SEE COS 1083)

From which:

Hemlock, 12 ins. dia., bears N44°W, 28.0 ft., mkd "1/4 S7 BT"

Spruce, 9 ins. dia., bears S56°E, 11.0 ft., mkd "1/4 S12 BT"

Douglas fir, 4 ins. dia., bears S24°W, 13.5 ft., attached location poster

1994 Record:
(Davis 4975 S)

Found 2-1/2 ins. dia. alum pipe w/ 3-1/4 ins. dia. alum. cap, firmly set 6 ins. above the ground.

From which:

Hemlock stump, 2 ft. high, 13-1/2 ins. dia., bears N44°W, 26.5 ft., scribed "1/4 S12 BT"

Sub Alpine Fir, 11 ins. dia., bears S56°E, 11.2 ft., scribed "1/4 S7 BT"

Douglas fir, 5-1/2 ins. dia., bears S24°W, 13.3 ft., w/ location poster

Established new bearing tree:

Douglas Fir, 5-1/2 ins. dia., bears S23°W, 13.3 ft., scribed "1/4 S12 BT"

Set a galvanized steel post, North, 2.0 ft., of the monument w/ LSM, USFS and property boundary decals

2010 Found:

We find a 3-1/4ins. dia. alum. cap, marked as shown below, on a 2-1/2 ins. dia. alum. pipe, rising 0.5 ft. from the ground.

From which:

Sub Alpine Fir stump, 11-1/2 ins. dia., bears S56°E, 11.2 ft., scribed "1/4 S7 BT"

Douglas Fir, 7 ins. dia., bears S23°W, 13.3 ft., scribed "1/4 S12 BT"

Decaying stump, bears N44°W, 26.5 ft., w/ no visible scribing


Galvanized steel post, bears North, 1.7 ft.

2010 Perpetuation:

We establish a new reference monument as follows:

Douglas Fir, 7 ins. dia., bears S43°E, 21.3 ft., scribed "1/4 S7 BT"

Bearing trees were affixed with BT tags, snow blazed and a painted red band.

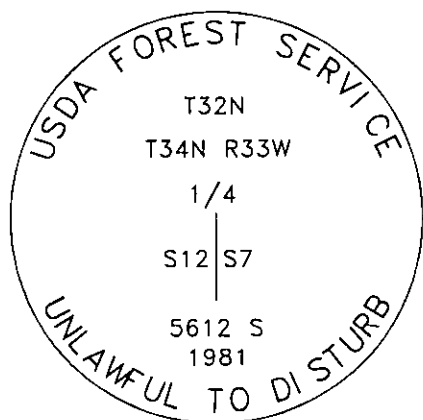

SKETCH OF CORNER

CERTIFICATION

I, Keith Brandt
certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Ken E Jenkins
certify that this Corner Record correctly represents work performed by me and under my direction in compliance with the Montana Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Signature of Surveyor & Seal

Date: 12/2010 Reg. No. 9330 LSEmployer: Montana Northwest Company


PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Office of Clerk and Recorder, County of _____ This "corner
record" was filed for record. 231796 BOOK: CCR CC&R'S PAGE: 11765 Pages: 1
STATE OF MONTANA LINCOLN COUNTY
was noted on the cross-index. RECORDED: 03/30/2011 11:16 KOI: CC&R'S
TAMMY D. LAUER CLERK AND RECORDER
book No. _____ FEE: \$0.00 BY: Deanna Deane Deputy
TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

County Official

Sec. 7

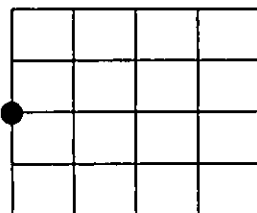Cross Index No. G 1 T. 32N R. 33W PMM

● - Corner this sheet