

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

**CERTIFIED CORNER RECORDATION**Corner: 1/4 Corner Section 19 & 24 T. 32N. R. 33 & 34W. P.M.M. Lincoln County

1903 GLO Record: Set limestone and established 2 bearing trees.

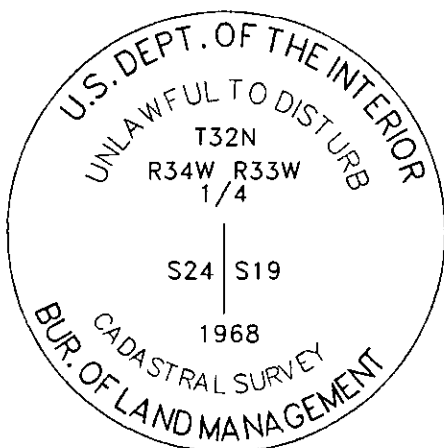
1915 Record: Cor #2 H.E.S. 417. Corner is identical w/ 1/4 section corner. Set stake alongside marked "2 HES" on south face & "X" on top of 1/4 corner stone for the exact corner point.  
USDA Established 2 bearing trees.1968 Record: BLM Remonumentation  
(Hill 5612S) Set an iron post, 30 ins. long, 2-1/2 ins. dia., 20 ins. in the ground, in a mound of stone w/ 3 ft. base. Topped w/ a brass cap. Buried original stone alongside.  
From which:  
Stump hole, bears N71°W, 20 lks (13.2 ft.), w/ fallen log mkd "1/4 S24"  
Pine, 15 ins. dia., bears S34°35'E, 55 lks (36.3 ft.), mkd "2 HES 417 BT"Established 2 new bearing trees:  
Pine, 8 ins. dia., bears N69°E, 65 lks (42.9 ft.), mkd "1/4 S 19 BT"  
Fir, 9 ins. dia., bears N85°15'W, 53 lks (35.0 ft.), mkd "1/4 S24 BT"2010 Found: We find a 3-1/4 ins. dia. brass cap, marked as shown below, on 2-1/2 ins. dia. steel pipe, rising 0.2 ft. from a mound of stone.  
From which:  
Lodge Pole stump, 8 ins. dia., bears N51°30'E, 31.8 ft., mkd "1/4 S19 BT"  
Douglas Fir, 13 ins. dia., bears N85°W, 35.3 ft., w/ overgrown blaze, BT

2010 Perpetuation: We establish new reference monuments as follows:

Douglas Fir, 9 ins. dia., bears N79°E, 30.4 ft., scribed "1/4 S19 BT"  
Alpine Fir, 13 ins. dia., bears S16°W, 42.4 ft., scribed "1/4 S24 BT"

We set a galvanized steel post, North, 1.1 ft. from the monument w/ LSM and USFS boundary decals.

Bearing trees were affixed with BT tags, snow blazed, and a painted red band.

**SKETCH OF CORNER****CERTIFICATION**I, Keith Brandt  
certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Ken E Jenkins  
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Signature of Surveyor &amp; Seal

Date: 11/2010 Reg. No. 9330 LSEmployer: Montana Northwest Company

PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Office of Clerk and Recorder, County of Lincoln. This "corner  
record" was filed for record 231800 BOOK: CCR CC&R'S PAGE: 11769 Pages: 1  
was noted on the cross-index STATE OF MONTANA LINCOLN COUNTY  
book No. 231800 RECORDED: 03/30/2011 11:19 KOI: CC&R'S  
TAMMY D. LAUER CLERK AND RECORDER  
FEE: \$0.00 BY: Therese Jensen Deputy

TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

County Official

Sec. 19

