

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner 4 of HES 738, 1 of HES 1241 T. 32 N. R. 33 W. Lincoln County

- I. 1917 HES 738 record by E.R. Johnson: Set a small stone marked with a cross(x) under a sandstone 26x10x8 ins., 16 ins. in the ground, marked 4 HES 738 on NE face and a cross(x) on top for exact corner point, from which

A cross(x) on a hemlock, tree 12 ins. diam., bears $N46^{\circ}30'E$, 28 lks. (18.48 ft.) dist.
 A cross(x) on a larch tree, 15 ins. diam., bears $N57^{\circ}W$, 32 lks. (21.12 ft.) dist.
 Each blazed and scribed 4 HES 738 BT."

- 1927 HES 1241 record by Harold Townsend: "I adopt this corner for Cor. No. 1 of this survey, and mark it 1 HES 1241 on SE face.

From which


A cross(x) on a balsam fir tree 7 ins. diam., bears $N22^{\circ}45'E$, 17 lks. (11.22 ft.) dist.
 A cross(x) on a balsam fir tree 7 ins. diam., bears $S72^{\circ}42'E$, 10 lks. (6.6 ft.) dist.
 Each blazed and scribed 1 HES 1241 BT.

- II. Found a stone, 8x12 ins., 6 ins. out of the ground with 4 HES 738 on NE face and 1 HES 1241 on SE face. From which

A fir, 12 ins. diam., bears $N24^{\circ}E$, 11.6 ft. dist., healed face.
 A hemlock, 24 ins. diam., bears $N57^{\circ}E$, 21.5 ft. dist., healed face. (Record: $N46^{\circ}30'E$, 18.48 ft.)
 A fir, 12 ins. diam., bears $S72^{\circ}E$, 7.2 ft. dist., healed face.
 A larch, 29 ins. diam., bears $N56^{\circ}W$, 10.1 ft. dist., healed face. (Record: $N57^{\circ}W$, 21.12 ft.)

- III. Painted red bands around the bearing trees and attached "Land Survey Monument" and "Bearing Tree" signs. Set a galvanized steel gaurd post with "Land Survey Marker" and Property Boundary decals, $N24^{\circ}W$, 3 ft.

Magnetic declination: 20° East

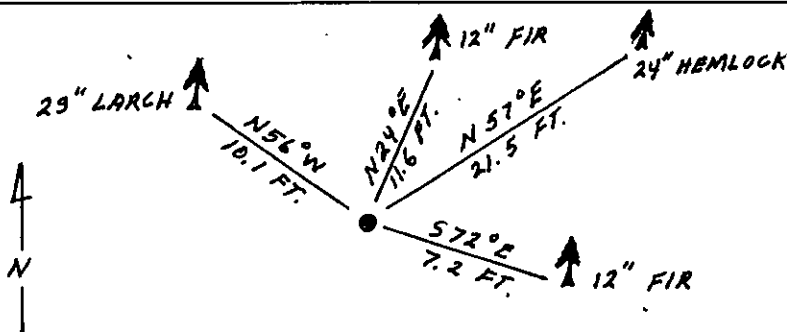

SKETCH OF CORNER

CERTIFICATION
 I, Kevin A. Todd
 certify the information shown herein is true and correct.
Kevin A. Todd
 Signature Ground Party Chief
 I, Ronald A. Pearson
 certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-24101, et seq., M.C.A.)
Ronald A. Pearson
 Signature of Surveyor & Seal
 Date: 11/16/92 Reg. No. 9008LS
 Employer: U.S. FOREST SERVICE


Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on 12-15-92 was noted on the cross-index plat and is assigned page No. 5187, in book No. Coral M. Cummings by KB

County Official

1 HES 1241 32 N 33W

Cross Index No. T. R. PMM

Sec. 8

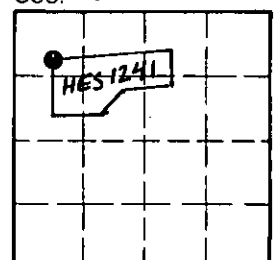

• - corner this sheet