INSTRUCTIONS

- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: 1/4 Corner, Section 18 & 13

T. 32N. R. 34 & 35W. P.M.M. Lincoln

1968 BLM Record:

Set 2-1/2 ins. dia. x 30 ins. long iron pipe, 24 ins. in the ground, with brass cap. Buried

original stone alongside. From which:

Hemlock, 13 ins. dia., bears S52°15'E, 29 lks (19.1 ft.), scribed "S18 BT" Cedar, 8 ins. dia., bears N32°W, 60 lks (39.6 ft.), scribed "S13 BT"

1982 Record: (Hill 5612 S)

Found 2-1/2 ins. dia. brass cap, approx. 8 ins. above the ground with a collar of stone.

From which:

Snag, 16 ins. dia., bears S43°E, (Record S52°15'E) 19.1 ft., mkd "1/4 S18 BT"

Cedar, 8 ins. dia., bears N35°W, 39.3 ft., mkd "1/4 S13 BT"

Established new bearing tree

Hemlock, 20 ins. dia., bears S19°W, 12.2 ft., mkd "S18 BT"

2010 Found:

We find a 3-1/4 ins. dia. brass cap, marked as shown below, on 2-1/2 ins. dia. steel pipe,

rising 0.6 ft. from the ground, from which:

Dead fall, 17 ins. dia., bears \$79°'E, 9.8 ft., no visible scribing, BT tag intact Hemlock, 20 ins. dia., bears S14°W (Record S19°W), 12.3 ft., w/ overgrown face

blaze & BT tag

Cedar, 13 ins. dia., bears N32°W, 39.3 ft., w/ overgrown face blaze

2010 Perpetuation:


We establish no new reference monuments.

We set galvanized steel fence posts, East, 1.2 ft. and South, 1.1 ft. from the monument w/

LSM and USFS boundary decals.

Bearing trees were affixed with BT tags, snow blazed and a painted red band.

We add stones around the monument.

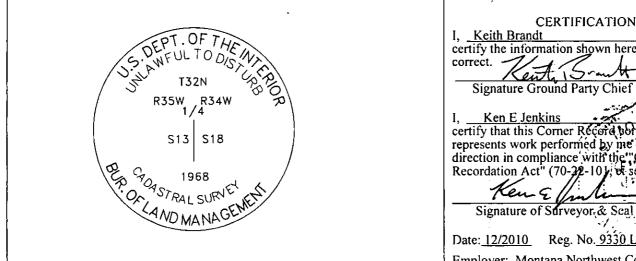

SKETCH OF CORNER

Keith Brandt certify the information shown herein is true and Signature Ground Party Chief Ken E Jenkins certify that this Corner Record borrectly represents work performed by me or under my direction in compliance with the "Corner, Recordation Act" (70-22-10); et seq., M.C.A.) Ken E Signature of Surveyor, & Scal

Date: 12/2010 Reg. No. 9330 LS Employer: Montana Northwest Company PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

| Office of Clerk and Recorder | Clerk and Recorder, County of | |
|------------------------------|---------------------------------------------------------------------------------|----------------------------|
| | STATE OF MONTANA LINCOLN COUNTY | PAGE: 11783 Pages: 1 |
| was noted on the cross-index | RECORDED: 03/30/2011 11:33 KOI: TAMMY D. LAUER CLERK AND RECORD FEE: \$0.00 BY: | CCER'S |
| book No. | TO: MOSTANA HORTHWEST COMPANY P.O. B County Official | OX 8777, MISSOULA, MONTANA |

| 500.10 | | | | |
|--------|--|--|--|--|
| | | | | |
| | | | | |
| | | | | |
| | | | | |

Sec 18