

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATIONCorner: 1/4 Corner Section 19 & 24 T. 32N. R. 33 & 34W. P.M.M. Lincoln County

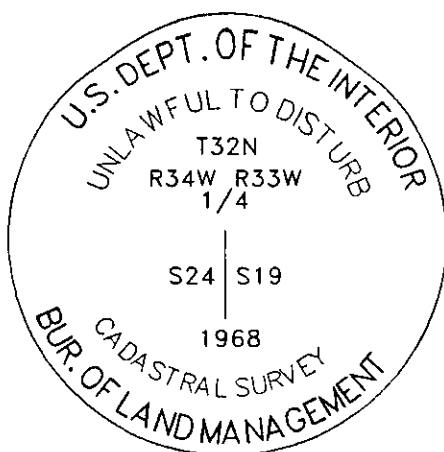
1903 GLO Record: Set limestone and established 2 bearing trees.

1915 Record: Cor #2 H.E.S. 417. Corner is identical w/ 1/4 section corner. Set stake alongside marked
USDA "2 HES" on south face & "X" on top of 1/4 corner stone for the exact corner point.
Established 2 bearing trees.1968 Record: BLM Remonumentation
(Hill 5612S) Set an iron post, 30 ins. long, 2-1/2 ins. dia., 20 ins. in the ground, in a mound of stone w/
3 ft. base. Topped w/ a brass cap. Buried original stone alongside.
From which:
Stump hole, bears N71°W, 20 lks (13.2 ft.), w/ fallen log mkd "1/4 S24"
Pine, 15 ins. dia., bears S34°35'E, 55 lks (36.3 ft.), mkd "2 HES 417 BT"Established 2 new bearing trees:
Pine, 8 ins. dia., bears N69°E, 65 lks (42.9 ft.), mkd "1/4 S 19 BT"
Fir, 9 ins. dia., bears N85°15'W, 53 lks (35.0 ft.), mkd "1/4 S24 BT"2010 Found: We find a 3-1/4 ins. dia. brass cap, marked as shown below, on 2-1/2 ins. dia. steel pipe,
rising 0.2 ft. from a mound of stone.
From which:
Lodge Pole stump, 8 ins. dia., bears N51°30'E, 31.8 ft., mkd "1/4 S19 BT"
Douglas Fir, 13 ins. dia., bears N85°W, 35.3 ft., w/ overgrown blaze, BT

2010 Perpetuation: We establish new reference monuments as follows:

Douglas Fir, 9 ins. dia., bears N79°E, 30.4 ft., scribed "1/4 S19 BT"
Alpine Fir, 13 ins. dia., bears S16°W, 42.4 ft., scribed "1/4 S24 BT"We set a galvanized steel post, North, 1.1 ft. from the monument w/ LSM and USFS
boundary decals.

Bearing trees were affixed with BT tags, snow blazed, and a painted red band.

**SKETCH OF CORNER****CERTIFICATION**I, Keith Brandt
certify the information shown herein is true and
correct.Keith Brandt
Signature Ground Party ChiefI, Ken E Jenkins
certify that this Corner Record correctly
represents work performed by me or under my
direction in compliance with the "Corner
Recordation Act" (70-22101, 5 U.S.C. 9330)Ken E Jenkins
Signature of Surveyor & SealDate: 11/2010 Reg. No. 9330 LSEmployer: Montana Northwest CompanyPO Box 8777, Missoula, MT 59807406-721-4033 Project No. 1617-10

Sec. 24

Office of Clerk and Recorder, County of Lincoln. This "corner
record" was filed for record on 231815 BOOK: CCR CC&R'S PAGE: 11784 Pages: 1
STATE OF MONTANA LINCOLN COUNTY
was noted on the cross-index plate RECORDED: 03/30/2011 11:34 KOI: CC&R'S
book No. TAMMY D. LAUER CLERK AND RECORDER
FEE: \$0.00 BY: Heather Lauer Deputy
TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

County Official

Cross Index No. P 25 T. 32N R. 34W PMM

● - Corner this sheet