INSTRUCTIONS

- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: Section Corner Secs 13, 18,19 & 24 T. 32N. R.33 & 34W. P.M.M. Lincoln County

GLO Record:

Set limestone and established 4 bearing trees.

1976 Record:

Found orig. limestone stone, loose in the ground.

(Shaw 2343S)

A Ponderosa Pine tree with good scribing.

A downed tree with good scribing.

Downed spruce, 10 ins. dia., bears N21°E

Fir snag, 24 ins. dia., bears S16°30'E, 33.66 ft., with scribing (Bearing tree)

Set 1-1/2 ins. dia. x 30 ins. brass cap pipe, 16 ins. in the ground, with a mound of stones.

From which:

Grand Fir, 5-1/2 ins. dia., bears N47°E, 17.24 ft., scribed "RM1" Larch, 9-1/2ins. dia., bears S52°E, 23.37 ft., scribed "RM2"

Ponderosa Pine, bears S61°W, 9.54 ft.

Grand Fir, 5-1/2 ins. dia., bears N60°W, 26.56 ft., scribed "RM3"

2010 Found:

We find a 2-1/2" brass cap, as shown below, on 2" dia. steel pipe, in a mound of stone, approx. 1.5 ft. high

x 2 ft. wide from which:

Grand Fir, 10 ins. dia., bears N45°30'E, 17.3 ft., w/ overgrown face blaze Larch, 16 ins. dia., bears S54°30'E, 23.6 ft., w/ overgrown face blaze

Ponderosa Pine, 26 ins. dia., bears S62°W, 9.8 ft., w/ partially visible scribing "2 34"


Grand Fir, 11 ins. dia., bears N60°W, 26.7 ft., w/overgrown face blaze

2010 Perpetuation:

We establish no new reference monuments.

BT tags are intact & in good condition. Paint red bands on the trees.

We set a galvanized steel post, South, 1.3 ft. from the monument, w/ LSM and USFS boundary decals.

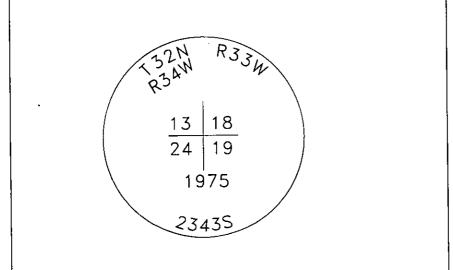

SKETCH OF CORNER

CERTIFICATION Keith Brandt certify the information shown herein is true and correct. ewl Signature Ground Party Chief certify that this Corner Record correctly represents work performed to the contract of the con represents work performed by me or under my direction in compliance with the Conner et segi, M.C.A.) Recordation Acti (70-2 9333 en Signature of Sur Reg. No. <u>9330 LŜ し</u> ピ Date: 11/2010 Employer: Montana Northwest Company PO Box 8777, Missoula, MT 59807 406-721-4033 Project No. 1617-10

			Sec. 24	
Office of Clerk and Recorder	, County of	This "corner	1 1	-
,	231818 BOOK: CCR CCGR'S	PAGE: 11787 Pages: 1		
record" was filed for record	STATE OF MONTANA LINCOLN COUNTY			
i	RECORDED: 03/30/2011 11:37 KOI:	CCGR'S	- - - -	一
was noted on the cross-index	TAMMY D. LAUER CLERK AND RECORDS			
book No.	TAMMY D. LAUER CLERK AND RECORDS SEE: \$0.00 BY: TO: MOSTASA SORTHWEST COMPANY P.O. BO	sio Llennes Aprity		\neg
	TO: HOSTABA SORTHWEST COMPANY P.O. BO	X 8777, MISSOULA, MOHTAÑA 🗸 📙		

County Official