1. Original and/or subsequent record used to evaluate the corner position.

2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.

3. Description of monument and accessories set to perpetuate the corner position.

- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories.
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: 1/4 Corner; Secs. 13,24

R. 34W. P.M.M. Lincoln County T.32N.

1966 BLM Record:

The 1/4 sec. cor. of secs. 13 and 24, monumented with a limestone, 16 ins. x 12 ins. x 7 ins., firmly set, mkd. "1/4" on the North face, and witnessed by the remains of the original bearing trees.

At the corner point set an iron post, 30 ins. long, 2-1/2 ins. dia., 22 ins. in the ground, with a brass cap from which the original bearing trees:

A stump hole, bears N41°45'E, 35 lks (23.1 ft.), (record). A pine, 14 ins. dia., bears S13°W, 55 lks (36.3 ft.), marked "1/4S24BT", (record).

The new bearing trees:

A fir, 13 ins. dia., bears N62°30'E, 4 lks (2.6 ft.), marked "1/4S13BT" A fir, 11 ins. dia., bears S54°W, 23 lks (15.2 ft.), marked "1/4S24BT"

Bury the original stone alongside iron post.

2010 Found:

We find a 3-1/4 ins. brass cap on a 2-1/2 ins. dia. alum. post rising 0.6 ft. from loose mound of stone, marked as shown below from which:


A Douglas fir, 14 ins. dia., bears N62°30'E, 2.6 ft., with an overgrown heel blaze. A Douglas fir, 19 ins. dia., bears S56°W, 14.8 ft., with an overgrown heel blaze.

2010 Perpetuation:

Bearing trees affixed with BT tags, LSM signs, snow blazed and painted red bands.

Steel spikes driven into BT's, side center at point of measurement.

We set galvanized steel post, North, 1.9 ft. and South 1.2 ft. from monument, with LSM and USFS boundary decals.

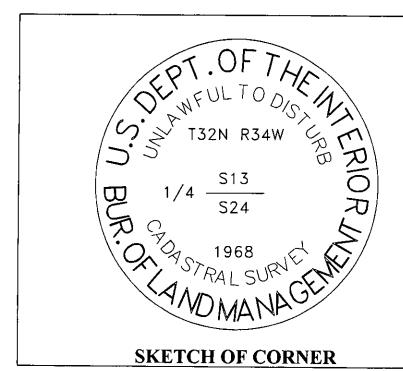

CERTIFICATION Keith Brandt certify the information shown herein is true and correct. Signature Ground Party Chief Ken E Jenkins certify that this Corner Record correctly represents work performed by me of under my direction in compliance with the "Corner Recordation Act" (70-22-101; ediseq.; N.C.A.) JEHK ... 9330. Signature of Surveyor & Seal Date: 11/2010 Reg. No. 9330 LS Employer: Montana Northwest Company P.O. Box 8777, Missoula, MT 59807 406-721-4033 Project No.1617-10

Office of Clerk and Recorder, County of		This "corner	Sec. 13		
	031006 7007 007 0001	PAGE: 11795 Pages: 1			
record" was filed for record	STATE OF MONTANA LINCOLN COUNTY	, , ,		 	_
was noted on the cross-inde:	RECORDED: 03/30/2011 11:44 KOI: 0				_
book No.	TAMMY D. LAUER CLERK AND RECORDER FEE: \$0.00 BY RECORDER	in Deune Aprily			_
	TO: MOSTABA SORTHWEST COMPANY P.O. BOX	8777, MISSOULA, MOSTANA			
	County Official	Ť •	•	,	