

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: 1/4 Corner; Secs. 14 and 23 T. 32N. R. 34W. P.M.M. Lincoln County

1966 BLM Record: The 1/4 cor. of secs. 14, and 23, monumented with a limestone, 15 ins. x 12 ins. x 8 ins., firmly set, mkd. "1/4" on North face, and witnessed by the remains of the original bearing trees.

At the corner point set an iron post, 30 ins. long, 2-1/2 ins. dia., 24 ins. in the ground, with a brass cap from which the original bearing trees:

A dead fir, 12 ins. dia., bears S30°30'E, 20 lks (13.2 ft.), marked "1/4 S"

A fir stump, 16 ins. dia., bears N30°30'W, 8 lks (5.3 ft.), marked "1/4 14BT"

The new bearing trees:

A fir, 13 ins. dia., bears S86°30'W, 87 lks (57.4 ft.), marked "1/4S23BT"

A fir, 14 ins. dia., bears N26°30'W, 37 lks (24.4 ft.), marked "1/4S14BT"

Bury the original stone alongside iron post.

2010 Found: We find a 3-1/4 ins. brass cap on a 2-1/2 ins. dia. iron post rising 0.7 ft. out of ground, marked as shown below from which:

A Larch snag, 14 ins. dia., bears S85°30'W, 57.4 ft., with an overgrown heel blaze.

A rotted stump, 12 ins. dia., bears N26°W, 5.8 ft., scribed "14"

A Grand fir snag, 17 ins. dia., bears N26°W, 24.5 ft., scribed "1/4S14BT"

2010 Perpetuation: Establish new bearing trees as follows:


A Douglas fir, 9 ins. dia., bears S49°E, 11.7 ft., scribed "1/4S23BT"

A Douglas fir, 12 ins. dia., bears N8°W, 15.3 ft., scribed "1/4S14BT"

Bearing trees affixed with BT tags, LSM signs, snow blazed and painted red bands.

Steel spikes driven into BT's, side center at point of measurement.

We set a galvanized steel post, West, 0.6 ft. from monument, with LSM and USFS boundary decals.

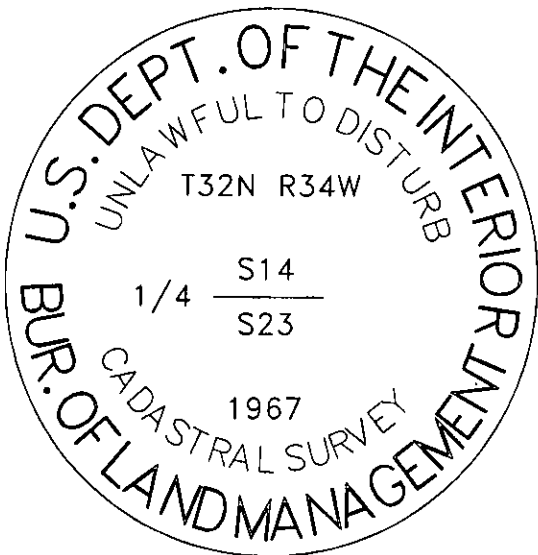

SKETCH OF CORNER

CERTIFICATION

I, Keith Brandt
certify the information shown herein is true and correct.

Keith Brandt
Signature Ground Party Chief

I, Ken E Jenkins
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101; et seq., M.C.A.)

Ken E Jenkins
Signature of Surveyor & Seal

Date: 11/2010 Reg. No. 9330 LS

Employer: Montana Northwest Company

P.O. Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Office of Clerk and Recorder, County of _____ This "corner

record" was filed for record 231828 BOOK: CCR CC&R'S PAGE: 11797 Pages: 1

was noted on the cross-index STATE OF MONTANA LINCOLN COUNTY

book No. _____ TAMMY D. LAUER CLERK AND RECORDER


FEE: \$0.00

BY: Heather Lauer

TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

County Official

Sec. 14

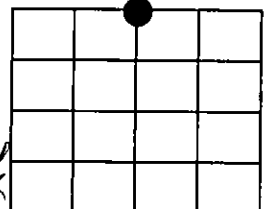

Cross Index No. N-19 T. 32N R. 34W PMM

● - Corner this sheet