

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: Section Corner; Secs 16, 17, 20 & 21 T. 32N. R. 34W. P.M.M. Lincoln County

GLO Record: Set limestone and established 4 bearing trees.

1982 Record: Found original stone. No evidence of original BT's for sections 17, 20 and 24. Found stump hole
(Hill 5612S) at record bearing and distance for section 16 BT.Set a 2-1/2 ins. dia. x 30 ins. alum. pipe w/ alum. cap, 25 ins. in the ground w/ a collar of stone.
Buried original stone alongside.

Established new bearing trees:

- Larch, 6 ins. dia., bears N28°E, 28.0 ft., mkd "S16 BT"
- Larch, 14 ins. dia., bears S45°E, 45.3 ft., mkd "S21 BT"
- Larch, 6 ins. dia., bears S47°W, 23.9 ft., mkd "S20 BT"
- Larch, 12 ins. dia., bears N43°W, 21.4 ft., mkd "S17 BT"

2010 Found: We find a 3-1/4 ins. dia. alum. cap, marked as shown below, on 2-1/2 ins. dia. alum. pipe, rising 0.4 ft.
above the ground.


From which:

- Larch, dead standing, 6 ins. dia., bears N26°E, 28.7 ft., face blazed & scribed "S16 BT"
- Larch, 9 ins. dia., bears N17°E, 37.4 ft., scribed "T32N R34W S21 BT"
- Larch, 14 ins. dia., bears S47°E, 45.1 ft., w/ overgrown face blaze, no visible scribing
- Larch, 8 ins. dia., bears S45°W, 24.4 ft., w/ overgrown face blaze, no visible scribing
- Larch, 13 ins. dia., bears N44°W, 21.3 ft., w/ overgrown face blaze, no visible scribing

2010 Perpetuation: We establish no new reference monuments.

We set galvanized steel posts, South, 3.6 ft. and East, 1.9 ft. from the monument w/ LSM and USFS
boundary decals.

Bearing trees were affixed with BT tags, snow blazed, and a painted red band.

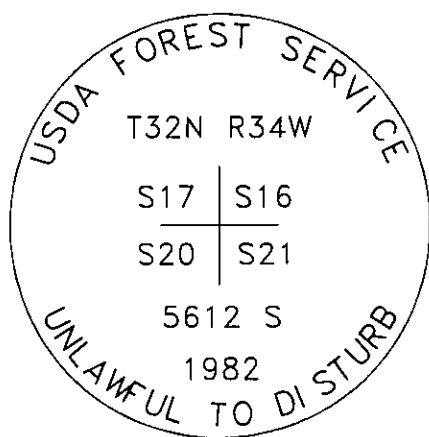

SKETCH OF CORNER

CERTIFICATION

I, Keith Brandt
certify the information shown herein is true and
correct.

Signature Ground Party Chief

I, Ken E Jenkins
certify that this Corner Record correctly
represents work performed by me or under my
direction in compliance with the "Corner
Recordation Act" (70-22-101, et seq., M.C.A.)

Signature of Surveyor & Seal

Date: 9/2010 Reg. No. 9330 LSEmployer: Montana Northwest Company

PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Sec. 16

Office of Clerk and Recorder, County of _____ This "corner
record" was filed for record of _____
was noted on the cross-index _____
book No. _____

231834 BOOK: CCR CCR'S PAGE: 11803 Pages: 1
STATE OF MONTANA LINCOLN COUNTY
RECORDED: 03/30/2011 11:52 KOI: CCR'S
TAMMY D. LAUER CLERK AND RECORDER
FEE: \$0.00 BY: Francis D. Lauer
TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA
County Official

