## INSTRUCTIONS



- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

Corner: Section Corner Secs 17, 18, 19, 20 T. 32N. R. 34W. P.M.M. Lincoln County

GLO Record:

Set pine post and established 4 bearing trees.

1982 Record:

Found no evidence of original pine post or S20 bearing tree.

(Hill 5612S)

Larch, 26 ins. dia., bears N36°E, 59.4 ft., visible scribing "S17 BT"

Larch, 30 ins. dia., bears N64°30'W, 38.2 ft., visible scribing "S18 BT"

Rotted stump (S19 BT)

Determined the corner position from the found BT's. Set a 2-1/2 ins. dia. x 30 ins. alum. pipe, 24 ins. in

the ground w/ a collar of stone and an alum. cap.

Established new bearing trees:

Cedar, 11 ins. dia., bears S48°W, 9.4 ft., mkd "S19 BT" Larch, 11 ins. dia., bears S37°E, 20.0 ft., mkd "S20 BT"

2010 Found:

We find a 3-1/4 ins. dia. alum. cap, as shown below, on 2-1/2" dia. pipe, set flush w/ a mound of stone,

from which:

Larch, dead fall, 26 ins. dia., bears N37°E, 59.6 ft., visible scribing "S" & blaze

Cedar, 12 ins. dia., bears S41°W, 8.9 ft., scribed "S19 BT"

Larch snag, 30 ins. dia., bears N63°W, 37.8 ft., visible scribing "S18" & blaze

Larch, blown down, 13 ins. dia., bears S42°E, 20.0 ft., no visible scribing, BT tag, snow blaze

2010 Perpetuation:

We establish new reference monuments as follows:


Hemlock, 10 ins. dia., bears N35°30'E, 28.1 ft., scribed "T32N R34W S17 BT"

Cedar, 6 ins. dia., bears S72°E, 12.8 ft., scribed "T32N R34W S20 BT"

White Pine, 17 ins. dia., bears N43°W, 25.3 ft., scribed "T32N R34W S18 BT"

We set galvanized steel posts, West, 1.4 ft. and East, 1.4 ft. from the monument w/ LSM and USFS boundary decals.

Bearing trees were affixed with BT tags, snow blazed, and a painted red band.

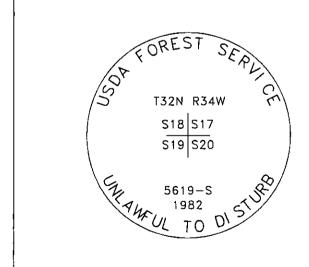

SKETCH OF CORNER

CERTIFICATION

Keith Brandt certify the information shown herein is true and Kent 6. correct.

Signature Ground Party Chief

Ken E Jenkins certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Ken Signature of Surveyor & Scal

Date: 9/2010 Reg. No. 9330 LS

Employer: Montana Northwest Company

PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

		Dec. I	
Office of Clerk and Recorder,	County of This "corner		
record" was filed for record or	231840 BOOK: CCR CCER'S PAGE: 11809 Pages: 1		
	STATE OF MONTANA LINCOLN COUNTY		
was noted on the cross-index	RECORDED: 03/30/2011 11:58 KOI: CC&R'S		$\longrightarrow$
	TAMMY D. LAUER CLERK AND RECORDER		
book No.	TO: MONTANA HORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA		
<del></del>	TO: MONTANA MORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA		
	County Official	,	

Sec. 17