INSTRUCTIONS

- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: 1/4 Corner; Sections 7 & 12

T. 32N. R. 33 & 34W. P.M.M. Lincoln County

1903 GLO Record:

Set limestone and established 2 bearing trees.

1982 Record: (Hill 5612S)

Found original stone lying loose on top of the ground. No evidence of original bearing trees was found. At determined proportional position, set a 2-1/2 ins. dia. x 30 ins. alum. pipe, 24 ins. in the ground w/ an alum. cap., in a collar of stone. Buried original stone alongside. (NOTE: SEE COS 1083)

From which:

Hemlock, 12 ins. dia., bears N44°W, 28.0 ft., mkd "1/4 S7 BT" Spruce, 9 ins. dia., bears S56°E, 11.0 ft., mkd "1/4 S12 BT"

Douglas fir, 4 ins. dia., bears S24°W, 13.5 ft., attached location poster

1994 Record: (Davis 4975 S) Found 2-1/2 ins. dia. alum pipe w/ 3-1/4 ins. dia. alum. cap, firmly set 6 ins. above the ground.

From which: Hemlock stump, 2 ft. high, 13-1/2 ins. dia., bears N44°W, 26.5 ft., scribed "1/4 S12 BT"

Sub Alpine Fir, 11 ins. dia., bears S56°E, 11.2 ft., scribed "1/4 S7 BT" Douglas fir, 5-1/2 ins. dia., bears S24°W, 13.3 ft., w/ location poster

Established new bearing tree:

Douglas Fir, 5-1/2 ins. dia., bears S23°W, 13.3 ft., scribed "1/4 S12 BT"

Set a galvanized steel post, North, 2.0 ft., of the monument w/ LSM, USFS and property

boundary decals

2010 Found:

We find a 3-1/4ins. dia. alum. cap, marked as shown below, on a 2-1/2 ins. dia. alum. pipe, rising 0.5 ft.

from the ground. From which:

Sub Alpine Fir stump, 11-1/2 ins. dia., bears S56°E, 11.2 ft., scribed "1/4 S7 BT"

Douglas Fir, 7 ins. dia., bears S23°W, 13.3 ft., scribed "1/4 S12 BT" Decaying stump, bears N44°W, 26.5 ft., w/ no visible scribing


Galvanized steel post, bears North, 1.7 ft.

2010 Perpetuation:

We establish a new reference monument as follows:

Douglas Fir, 7 ins. dia., bears S43°E, 21.3 ft., scribed "1/4 S7 BT"

Bearing trees were affixed with BT tags, snow blazed and a painted red band.

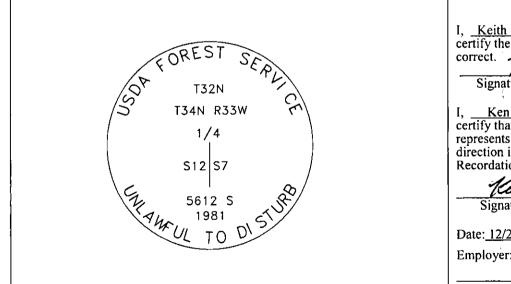

SKETCH OF CORNER

CERTIFICATION I, Keith Brandt certify the information shown herein is true and Signature Ground Party Chief OUTA Ken E Jenkins certify that this Corner Record correctly... represents work performed by me or under my direction in compliance with the Enthart Recordation Act" (70-22-101, et sett. M.C.A.) 9330L Ken a Signature of Surveyor & Seal 31 15 Date: 12/2010 Reg. No. <u>9330 LS</u> Employer: Montana Northwest Company PO Box 8777, Missoula, MT 59807 406-721-4033 Project No. 1617-10

	errot to the		Sec. 12	
Office of Clerk and Recorder, County of	. This "corner			
231881 BOOK: CCR CCER'S	PAGE: 11824 Pages: 1	1 1	·	
record" was filed for record on _ state of montana lincoln county	-4			
was noted on the cross-index placement D. LAUER CLERK AND RECORDE			<u> </u>	
HERE	ne Seanu dyne	 	\longrightarrow	
book No To: MONTANA MONTHWEST COMPANY' P.O. BO	X 8777 MISSOULA MORTANA			

County Official