

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATIONCorner: 1/4 Sec Corner, Sec 3 & 34 T. 31& 32N. R. 34W. P.M.M. Lincoln County

GLO Record: Set limestone and established 2 bearing trees.

1982 Record: Found the original stone, from which:
(Hill 5612S) Larch, 24 ins. dia., bears S76°E, 90.4 ft., w/ visible scribing
No evidence of S34 BT found.

Set 3 ins. dia. x 30ins. alum. pipe, 24 ins. in the ground, with an alum. cap. Built a collar of stone around the monument. Buried the original stone alongside.

From which:

Douglas Fir, 10 ins. dia., bears North, 10.6 ft., mkd "1/4 S34 BT"

2010 Found: We find a 3-1/4 ins. dia. alum cap, marked as shown below, on 2-1/2 ins. dia. pipe, rising 0.5 ft. from the ground.

From which:

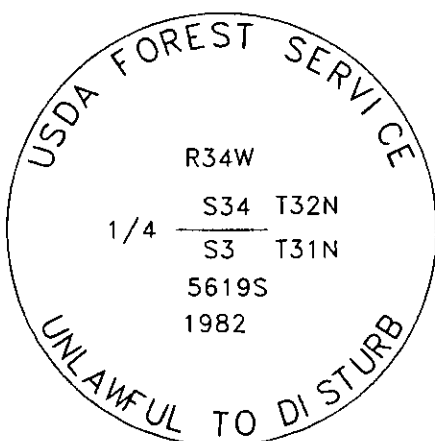
Fir, down fall, 10 ins. dia., bears North, 10.3 ft., w/ blaze, visible scribing & BT tag

Larch, 17 ins. dia., bears S76°30'E, 90.6 ft., w/ partial scribing "1/4 3 B"

2010 Perpetuation: We establish new reference monuments as follows:
Grand Fir, 11 ins. dia., bears S86°30'W, 34.2 ft., scribed "1/4 S3 BT"
Lodge Pole Pine, 7 ins. dia., bears N13°30'W, 6.5 ft., scribed "T32N R34W 1/4 S34 BT"

We set galvanized steel posts, West, 1.4 ft. and East, 1.5 ft. from the monument w/ LSM and USFS boundary decals.

Bearing trees were affixed with BT tags, snow blazed and a painted red band.

**SKETCH OF CORNER****CERTIFICATION**I, Keith Brandt

certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Ken E Jenkins

certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Signature of Surveyor & Seal

Date: 10/2010 Reg. No. 9330 LSEmployer: Montana Northwest Company

PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Office of Clerk and Record: 231893 BOOK: CCR CC&R'S PAGE: 11836 Pages: 1

record" was filed for record STATE OF MONTANA LINCOLN COUNTY
RECORDED: 03/31/2011 10:11 KOI: CC&R'S

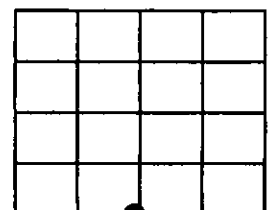
was noted on the cross-index TAMMY D. LAUER CLERK AND RECORDER

book No. FEE: \$0.00

BY:

TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

County Official

Sec. 34Cross Index No. Z15 T. 32N R. 34W PMM

● - Corner this sheet