

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

Corner: Section Corner, Secs 3, 4, 33 & 34 T. 31 & 32N. R. 34W. P.M.M. Lincoln County

GLO Record: Set limestone and established 4 bearing trees.

1982 Record: Did not find original stone, falls in road.  
(Staab 5619S) Found: Rotten Stump, bears N23°30'E, 50 lks (33.0 ft.), w/ large overgrown blaze  
Pine, 30 ins. dia., bears S34°E, 30 lks (19.8 ft.), w/ visible scribe

Set a 32 ins. x 3-1/2 ins. dia. alum. pipe, 25 ins. in the ground w/ alum. cap. Raised a collar of stone around monument. From which:

Hemlock, 7 ins. dia., bears N68°E, 58 lks (38.3 ft.), marked "T32N R34W S34 BT"

Cedar, 16 ins. dia., bears S73°W, 78 lks (51.5 ft.), marked "T31N R34W S4 BT"

Hemlock, 8 ins. dia., bears N30°W, 79 lks (52.1 ft.), marked "T32N R34W S33 BT"

2010 Found: We find a 3-1/4 ins. dia. alum cap, marked as shown below, on 2-1/2 ins. dia. pipe, rising 0.4 ft. from a mound of stone, from which:

Hemlock, 9 ins. dia., bears N72°E, 24.1 ft., (Record N68°E, 38.3 ft.), scribed

"T32N R34W S34 BT" w/ BT tags

White Pine snag, 24 ins. dia., bears S29°E, 20.0 ft., w/ partially overgrown blaze, scribed "3"

Cedar, 14 ins. dia., bears S76°W, 51.8 ft. (Record S73°W), scribed "T31N R34W S4 BT"

w/ BT tags


2010 Perpetuation: We establish new reference monuments as follows:

Hemlock, 7 ins. dia., bears S21°E, 21.8 ft., scribed "T31N R34W S3 BT"

There are no suitable trees for a BT in Section 33, area has been heavily logged.

We set galvanized steel posts, West, 1.8 ft. and East, 1.85 ft. from the monument w/ LSM and USFS boundary decals.

Bearing trees were affixed with BT tags, snow blazed and a painted red band.

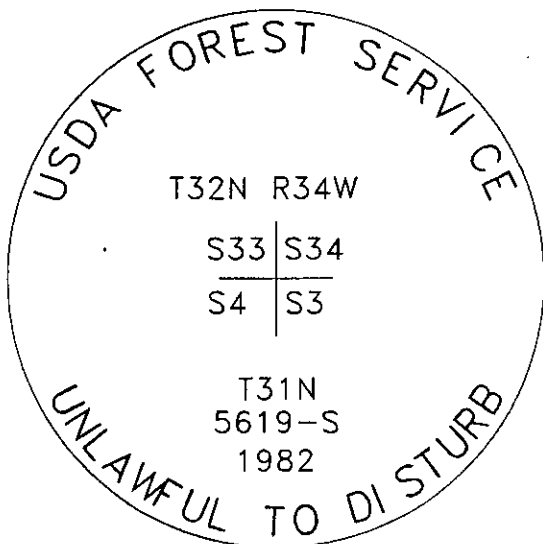

**SKETCH OF CORNER**

### CERTIFICATION

I, Keith Brandt  
certify the information shown herein is true and correct.

*Keith Brandt*  
Signature Ground Party Chief

I, Ken E Jenkins  
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the Montana Recordation Act" (70-22-101, M.C.A.)

*Ken E Jenkins*  
Signature of Surveyor & Seal

Date: 10/2010 Reg. No. 9330 LS

Employer: Montana Northwest Company


PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Sec. 33

Office of Clerk and Recorder, County of \_\_\_\_\_ This "corner record" was filed for record 231894 BOOK: CCR CCR'S PAGE: 11837 Pages: 1  
STATE OF MONTANA LINCOLN COUNTY  
was noted on the cross-index: RECORDED: 03/31/2011 10:12 KOI: CCR'S  
TAMMY D. LAUER CLERK AND RECORDER  
book No. \_\_\_\_\_ FEE: \$0.00 BY: *Tammy D. Lauer*  
TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

County Official

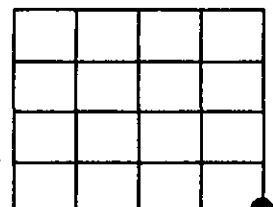

Cross Index No. Z 13 T. 32N R. 34W PMM

● - Corner this sheet