

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATIONCorner: C-1/4 Corner: Sec. 36 T. 32N. R. 34W. P.M.M. Lincoln County

Record: Found a railroad tie marking the position of the C-1/4 of Section 36. There is no original record of how this position was determined, but is referred to on corner recordation form (BK. 1, PG. 255) filed by J.W. Ninneman 534 ES in 1972 as being set during a previous survey. This corner position is referenced and used as control for further subdivision of the section as recorded on corner recordation form (BK.1, PG. 478), filed by J.W. Ninneman, 534 ES, and Certificates of Survey numbers: 209, 304, 305, 343 and 564 also being filed by J.W. Ninneman, 534 ES.

1983 Record:
(Hill, 5612S)

Found a railroad tie 8 ins. x 6 ins., 2.5 ft. out of the ground, marked "36" on the NE face, from which a snag bears N35°E, 11.6 ft., marked "BT". We determined a center quarter corner position at the intersection of the north-south and east-west section centerlines, from this corner position the railroad tie bears N43°41'E, 23.0 ft. The position as occupied by the railroad was rejected because; 1) there was no reliable survey history, 2) no material evidence could be substantiated that the corner position was determined using accepted procedures, i.e., at the intersection of the lines connecting opposite quarter section corners.

Set a 2-1/2 ins. x 30 ins. aluminum pipe, 25 ins. in the ground at determined corner position from which:

A cedar, 7 ins. diam. bears N16°E, 11.9 ft., marked "X BT".

A larch, 7 ins. diam. bears S7°E, 6.2 ft., marked "C 1/4 S36 BT".

2010 Found:

We find a 3-1/4 ins. diam. aluminum cap, marked as shown below from which:

A dead, standing cedar, 13 ins. diam. bears N19°E, 11.9 ft., with an overgrown heel blaze.

A larch, 14 ins. diam. bears S11°E, 6.2 ft., with an overgrown heel blaze.

A railroad tie, 6 ins. x 8 ins., 2ft. high bears N44°E, 23.0 ft.

2010 Perpetuation:

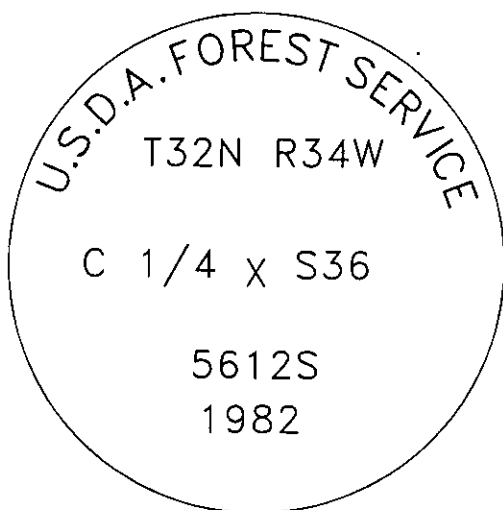
We establish bearing tree as follows:

A larch, 7 ins. diam. bears N40°W, 33.8 ft., scribed "C 1/4 S36 RM".

Bearing trees affixed with BT tags, LSM signs, snow blazed and painted red bands.

Metal spike driven into BT's side center at point of measurement

Set a galvanized steel post East, 1.8 ft of the monument with LSM and USFS boundary decals.

**SKETCH OF CORNER****CERTIFICATION**

I, Travis R. Williams
certify the information shown herein is true and correct.

Travis R. Williams
Signature Ground Party Chief

I, Ken E Jenkins
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the Corner Recordation Act" (70-22-101, et seq., M.C.A.).

Ken E Jenkins
Signature of Surveyor & Seal

Date: 12/2010 Reg. No. 9330 LS

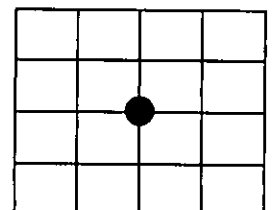
Employer: Montana Northwest Company

P.O. Box 8777, Missoula, MT 59807

406-721-4033 Project No.1617-10

Office of Clerk and Recorder, County of Lincoln 231899 BOOK: CCR CC&R'S PAGE: 11842 Pages: 1
record" was filed for record on 03/31/2011 10:17 STATE OF MONTANA LINCOLN COUNTY
was noted on the cross-index plat KOI: CC&R'S
book No. TAMMY D. LAUER CLERK AND RECORDER
FEE: \$0.00 BY: Travis R. Williams
TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA
County Official

Sec. 36

Cross Index No. X-23 T. 32N R. 34W PMM

● - Corner this sheet