

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

**CERTIFIED CORNER RECORDATION**

Section Corner  
Corner: Secs 30, 31, 25 & 36 T. 32N. R. 34 & 35W. P.M.M. Lincoln County

1903 GLO Record: Set limestone and established 4 witness trees

1967 Record: Found a granite stone & 2 bearing trees.  
(Damm) Set brass cap on iron post. Established 3 bearing trees. Buried original stone alongside monument.

1988 Record: Found BLM brass cap, 3-1/4 ins. dia., on a 2-1/2 ins. dia. iron pipe, 8 ins. out of the ground.  
(Hill 5612S) From which:

Cedar, 13 ins. dia., bears N32°E, 53 lks (35 ft.), w/ visible scribing  
Stump, 6 ft. high, bears S24°E, 7 lks (4.6 ft.), w/ visible scribing  
Snag, bears S32°W, 23 1/2 lks (15.5 ft.), w/ visible scribing  
Cedar, 8 ins. dia., bears N54°W, 77 lks (50.8 ft.), w/ visible scribing  
Fallen tree, bears N35°W, 37 lks (24.4 ft.), w/ visible scribing

Established new reference monuments as follows:

Fir, 5 ins. dia., bears S20°E, 19 lks (12.5 ft.), mkd "T32N R34W S31 BT"  
Cedar, 5 ins. dia., bears S52°W, 7 lks (4.6 ft.), mkd "T32N R35W S36 BT"

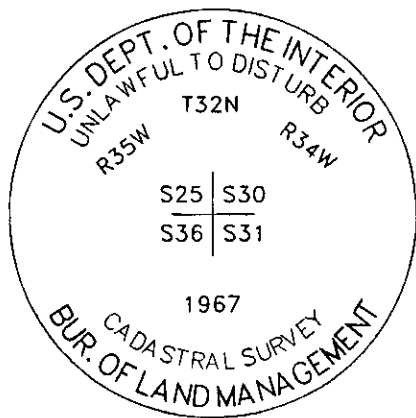
2010 Found: We find a 3-1/4 ins. dia. brass cap on 2-1/2 ins. dia. steel pipe, marked as shown below, rising 0.7 ft. from the ground. From which:

Cedar, 12 ins. dia., bears N32°30'E, 34.7 ft., w/ visible scribing "S30 BT" & BT tag  
Douglas Fir, 9 ins. dia., bears S21°E, 12.5 ft., w/ healed face blaze & BT tag  
Cedar, 9 ins. dia., bears S56°W (Record S52°W), 4.6 ft., scribed "T32N R35W S36 BT"  
Cedar, 12 ins. dia., bears N53°W, 50.2 ft., w/ overgrown blaze & LSM tag

2010 Perpetuation: We establish no new reference monuments.

We set a galvanized steel post, North, 1.3 ft. from the monument w/ LSM and USFS boundary decals.

Bearing trees were affixed with BT tags and a painted red band.

**SKETCH OF CORNER****CERTIFICATION**

I, Keith Brandt  
certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Ken E Jenkins  
certify that this Corner Record correctly represents work performed by me in the direction in compliance with the "Montana Recordation Act" (70-22-101, et seq., M.C.A.)

Signature of Surveyor & Seal

Date: 12/2010 Reg. No. 9330 LS

Employer: Montana Northwest Company

PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Office of Clerk and Recorder, County of Lincoln. This "corner  
record" was filed for record c 231903 BOOK: CCR CC&R'S PAGE: 11846 Pages: 1  
was noted on the cross-index STATE OF MONTANA LINCOLN COUNTY  
book No. TAMMY D. LAUER CLERK AND RECORDER  
RECORDED: 03/31/2011 10:21 KOI: CC&R'S  
FEE: \$0.00 BY: Deanna Lauer Deputy

TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

County Official

Sec. 31

