

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: 1/4 Corner; Secs. 14 and 15 T. 32N. R. 34W. P.M.M. Lincoln County

Record: Corner position falls on a limestone rock in place, 4ft. x 2ft. x 1ft., above ground. Cut a cross at the exact corner point for 1/4 sec. corner. Marked "1/4" on the West side from which:

A Pine, 30 ins. dia., bears S76°E, 78 lks (51.5 ft.), marked "1/4 S14 BT"

A Pine, 32 ins. dia., bears S1°30'W, 32 lks (21.1 ft.), marked "1/4 S15 BT"

1976 Record

(J.T. Shaw, 2343S): No evidence of corner monument found. Found a 36 ins. Ponderosa pine with scribing and a pine lying on the ground with scribing. We measure original distances from two bearing trees and the intersection point falls on a rock in place. At the intersection point we set a 4 ins. dia. brass disk in the rock from which:

A Ponderosa pine, 10 ins. dia., bears S72°W, 27.64 ft., (Slope dist).

A Ponderosa pine, 16 ins. dia., bears N54°W, 68.58 ft.

2010 Found: We find no evidence of monument. 1976 record bearing trees are present.

2010 Perpetuation: We establish corner position by way of dist/dist intersection using 1976 record distances from existing bearing trees. Position falls on steep rock face. We set a 5/8 ins. x 24 ins. rebar with a 3-1/4 ins. alum. cap, marked as shown below. We build a sturdy rock mound with a 5 ft. base to encase the monument from which:

A Ponderosa pine, 18 ins. dia., bears S72°W, 27.64 ft., (Slope dist), with an over grown heel blaze.

A Ponderosa pine, 20 ins. dia., bears N54°W, 68.58 ft., with an over grown heel blaze.

Bearing trees affixed with BT tags, LSM signs, snow blazed and painted red bands.
Metal spike driven into BT's side center at point of measurement
Set a galvanized steel post N9°W, 3.95 ft. from the monument, with LSM and USFS boundary decals.



SKETCH OF CORNER

CERTIFICATION

I, Keith Brandt
certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Ken E Jenkins
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the Montana Corner Recordation Act" (70-22-101, et seq.)

Signature of Surveyor & Seal

Date: 1/2011 Reg. No. 9330 LS

Employer: Montana Northwest Company

P.O. Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Office of Clerk and Recorder, County of _____ This "corner

record" was filed for record

was noted on the cross-index

book No. _____

231909 BOOK: CCR CCR'S PAGE: 11852 Pages: 1

STATE OF MONTANA LINCOLN COUNTY

RECORDED: 03/31/2011 10:27 KOI: CCR'S

TAMMY D. LAUER CLERK AND RECORDER


FEE: \$0.00

BY: Keith Brandt

TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

County Official

Sec. 14

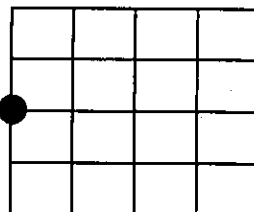

Cross Index No. L-17 T. 32N R. 34W PMM

● - Corner this sheet