INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.

2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.

3. Description of monument and accessories set to perpetuate the corner position.

- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

W 1/16 Sec Corner

Corner: Sections 1 & 36

T. 31& 32 N. R. 34W. P.M.M. <u>Lincoln</u> County

1986 Record: (Davis 4975S) Set USDA Alum. cap and pipe 3-1/4 ins. dia. x 30 ins. long

From which:

Red fir, 10 ins. dia, bears N62°W, 101 ft., scribed "W1/16 S36 BT", notched at

root crown, painted red band & attached BT sign.

Black pine, 18 ins. dia., bears S36°W, 20.4 ft., scribed W1/16 S1 BT", notched at

root crown, painted red band & attached BT sign

1994 Record: (Hughes 7322 LS) Found a 2-1/2 in. dia. alum. pipe, 6 ins. above the ground, firmly set in a collar of stone

w/ 3-1/4 ins. dia. USDA alum. cap.

From which:

Pine, 20 ins. dia., bears S20°W, 20.6 ft. w/ "6" visible (1986 Record S36°W) Fir, 10 ins. dia., bears N75°W, 101 ft., w/ "BT" visible (1986 Record N62°W)

2010 Found:

We find a 3-1/4 ins. dia. USDA alum. cap on 2-1/2 ins. dia. alum. pipe, as shown below,

rising 0.1 ft. from the ground.

From which:

Ponderosa Pine, 23 ins. dia., bears S23°W, 20.6 ft. w/ overgrown blaze & BT tag Douglas Fir, 10 ins. dia., bears N75°30' W, 101 ft., w/ overgrown blaze & BT tag

Steel fence post, bent & loose, bears West, 2.0 ft., w/ survey decals


2010 Perpetuation:

We establish no new reference monuments.

We set a galvanized steel post, West, 2.35 ft. from the monument w/ LSM and USFS

boundary decals.

Bearing trees were affixed with BT tags, snow blazed and a painted red band.

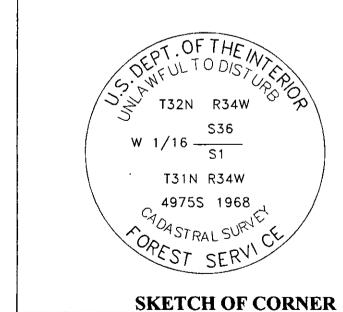

CERTIFICATION Keith Brandt

certify the information shown herein is true and correct.

Signature Ground Party Chiefer

NONTAN Ken E Jenkins certify that this Corner Record correctly represents work performed by me or under direction in compliance with the "Carrel Recordation Act" (70-22-101, et seal, MIC

Signature of Surveyor & Shall

Date: 12/2010 Reg. No. 9330 L

Employer: Montana Northwest Company

PO Box 8777, Missoula, MT 59807

406-721-4033 Project No. 1617-10

Office of Clerk and Recorder, County of	This Balance		Sec. 36		
231911 BOOK: CCP CCCP C	This "corner PAGE: 11854		\top		
record" was filed for record on STATE OF MONTANA LINCOLN COUNT	Y	Pages: 1 —	 		
Was noted on the cross-index plat: TAMMY D. LAUER CLERK AND RECORD	I: CCGR'S	·			
book No. FEE: \$0.00 BY:	RDER	, . , , <u>,</u>	+		
book No. To: MONTANA HORTHWEST COMPANY P.O.	BOX 8777, MISSOULA	- defecty			
County Official		, montana —			