

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATIONCorner: 1/4 Corner, Secs. 19 & 24 T. 32N. R. 34 & 35W. P.M.M. Lincoln County

1903 GLO Record: Set granite stone and established 2 bearing trees.

1987 Record:
(Hughes 7322 LS) Found granite stone, lying upside down in a small mound of stones.
From which:Hemlock snag, 6 ft., bears N58°E, 2.5 ft. w/ visible scribing "1/4 S19 BT"
Stump hole, bears S76°W, 12.6 ft.
Distances were measured from the center of the marked stone.

The position of the stone was not accepted as the original corner position. The plainly scribed hemlock snag was accepted as the best available evidence for reestablishing the corner. At GLO bearing and distance from the snag, set a 2-1/2 ins. dia. x 30 ins. alum. post, 24 ins. in the ground, in a mound of earth, w/ 3-1/4 ins. dia. alum cap. Buried the original stone on west edge of monument.

From which:

The scribed hemlock snag, bears N47°E, 3.3 ft.
Stump hole, bears S80°W, 12.1 ft.

Established new bearing trees:

Douglas Fir, 5 ins. dia., bears East, 20.7 ft., scribed "1/4 S19 BT"
Grand Fir, 6 ins. dia., bears S09°W, 18.3 ft., scribed "1/4 S24 BT"

Set galvanized steel post, North, 2.0 ft., w/ LSM and USFS boundary decals.

2010 Found: We find a 3-1/4 ins. dia. alum. cap, marked as shown below, on 2-1/2 ins. dia. alum. pipe, rising 0.4 ft. from the ground. From which:

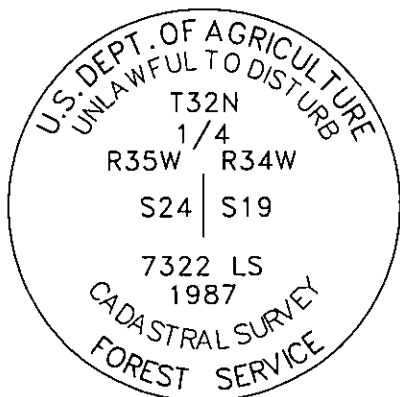
Rotten stump, 18 ins. dia., bears N47°E, 3.7 ft., w/ BT tag
Grand Fir, 10 ins. dia., bears East, 20.7 ft., w/ overgrown blaze & BT tag
Grand Fir snag, 12 ins. dia., bears S07°W, 18.5 ft., w/ overgrown blaze & BT tag
Galvanized steel post, bears North, 1.7 ft.

2010 Perpetuation: We establish new reference monuments as follows:

Cedar, 15 ins. dia., bears N64°W, 18.9 ft., scribed "1/4 S24 BT"

We set a galvanized steel fence post, South, 0.65 ft. from the monument w/ LSM and USFS boundary decals.

Bearing trees were affixed with BT tags, snow blazed and a painted red band.

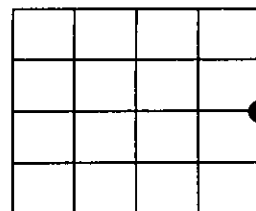
**SKETCH OF CORNER****CERTIFICATION**I, Keith Brandt
certify the information shown herein is true and correct.Keith Brandt
Signature Ground Party ChiefI, Ken E Jenkins
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.).Ken E Jenkins
Signature of Surveyor & SealDate: 9/2010 Reg. No. 9330 LSEmployer: Montana Northwest CompanyPO Box 8777, Missoula, MT 59807406-721-4033 Project No. 1617-10

Office of Clerk and Recorder, County of _____ This "corner

record" was filed for record on 231916 BOOK: CCR CC&R'S PAGE: 11859 Pages: 1was noted on the cross-index p STATE OF MONTANA LINCOLN COUNTY
RECORDED: 03/31/2011 10:34 KOI: CC&R'Sbook No. _____ TAMMY D. LAUER CLERK AND RECORDER
FEE: \$0.00 BY: Tammy D. LauerTO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

County Official

Sec. 24

Cross Index No. P25 T. 32N R. 35W PMMP1 32 34

● - Corner this sheet