
xl/or subsequent record used to eval



Description of monument and accessories set to perpetuate the corner position.

Steetch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc. Certification must be signed and scaled by Land Surveyor registered in the State of Montans.

Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

P.M.M. Lincoln Corner 4Cor Secs 8 & 17 __ T.<u>33N</u>_ R. 34W

Original Record- GLO 1903 Set a Tamarack post, 3' long, 4" square, 24" in the ground for $\frac{1}{4}$ Section Corner, marked $\frac{1}{4}$ S8 on North, and 17 on South faces, from which:

A Pine, 6" diameter bears S7°15'W, 24 links (15.84'). A Tamarack, 5" diameter, bears N17°W, 37 links (24.42')


Re-establishment by Goacher 1987

Found no original evidence. By single proportion plastic cap stamped Goacher 7318-S, from which: By single proportion set a 5/8"x 24" rebar with 11/4" orange


A 24" Douglas Fir bears N40°E, 35.3' distant, scribed $\frac{1}{4}S$ BT. A 22" Douglas Fir bears South, 21.3' distant, scribed $\frac{1}{4}S$ BT.

Found 5/8" rebar and plastic cap per record. 21

Replaced the found rebar and cap with a standard Forest Service aluminum monument, set 24" in the ground, marked as shown:

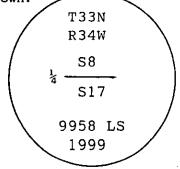

Existing bearing trees are alive and in good condition. Blazes and scribing were painted red, new bearing tree tags were attached to trees. Bearings and distances to trees are the same as Goacher record.

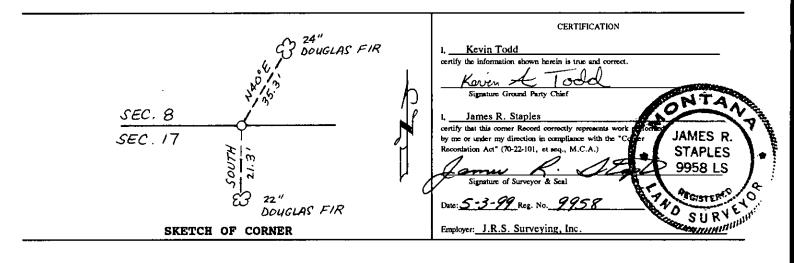

ν	Sec.	17	,	
Office of Clerk and Recorder, County of Junction. This "corner				!
record" was filed for record on				
was noted on the cross-index plat and is assigned page Noin	\vdash		\longrightarrow	
book No. 10328 (oral M. County Official) MB				
country officially pages				

J-7 T. 33N R. 34W Cross Index No. PMM