
## INSTRUCTIONS

or subsequent record used to evaluate the corner position.



Description of evinence found, not underspinitive in the feeding, and relation to be because the control position. Sketch of corner, show all pertinent data which can best be shown in a sketch exam

ole, corner marking, topography ties, position of accessories, etc.

Certification must be signed and scaled by Land Surveyor registered in the State of Montana.
Fill in Cross Index & Section Diagram at bottom of sheet.


## CERTIFIED CORNER RECORDATION

Corner S1/16 Sec 17- west line T. 33N R. 34W P.M.M. Lincoln County

1) No records found at Lincoln County Courthouse.

No evidence found on the ground. 2)

At the corner position as determined by survey, set a 5/8"x 30" rebar, with a  $3\frac{1}{4}$ " aluminum cap, marked as shown:

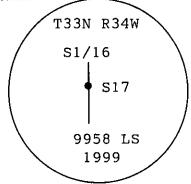


Accessories are as follows: State Boundary Post #38 bears North, 7.16'. Two existing bearing trees for State Boundary Post #38 are used here as accessories to the S1/16 even though the trees as scribed clearly reference State Boundary Post #38.

A 13" Douglas Fir, bears N60°E, 58.6' distant, scribed MONT P38 BT. A 13" Douglas Fir, bears N18°W, 50.8' distant, scribed IDAHO P38 BT.

Blazes and scribing were painted red. Bearing tree tags and Land Survey Monument signs were attached to trees. A 6' steel post with Land Survey Monument and Forest Service Property Boundary decals attached was placed 2' east of monument.

Note: Original scribing and scribing scars are oriented to the State Boundary Post. Bearing tree tags are oriented to the 5/8" rebar and aluminum cap.

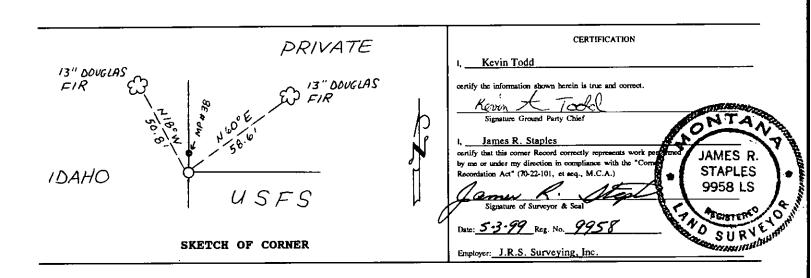

$\rho$ . $\rho$	Sec. 17		
Office of Clerk and Recorder, County of Marie. This "corner			
record" was filed for record on			
was noted on the cross-index plat and is assigned page Noin book No. 10333			
County Official BUB			

Cross Index No. M-5 T. 33N R. 34W PMM