- uent record used to evaluate the corner position
- Description of evidence found, not discrepacies in the record, state method of establishing lost or obliterated corners

Description of monument and accessories set to perpetuate the corner position.

- Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc
- Certification must be signed and sealed by Land Surveyor registered in the State of Montana.


 Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner W-E-E1/256 COR SECS 17&20 T. 33N R. 34W P.M.M. Lincoln County

- No records found at Lincoln County Courthouse 1)
- 2) No evidence found on the ground


At the corner position as determined by survey, set a 5/8"x 30" rebar, with a $3\frac{1}{4}$ " aluminum cap marked as shown:

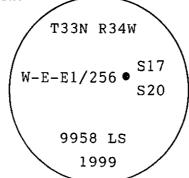

From which:

A 13" Douglas Fir bears S81°E, 116.3' distant, scribed W E E1/256 S20 BT. A 14" Douglas Fir bears N79°E, 80.1' distant, scribed W E E1/256 S17 BT.

Monument was set 0.6' above grade on cut slope approximately 11' westerly of west edge of Highway 2. A 6' steel post with Land Survey Monument and Forest Service property boundary decals attached was placed 1' east of monument. Blazes and scribing on bearing trees were painted red. Bearing tree tags and Land Survey monument signs were attached to trees.

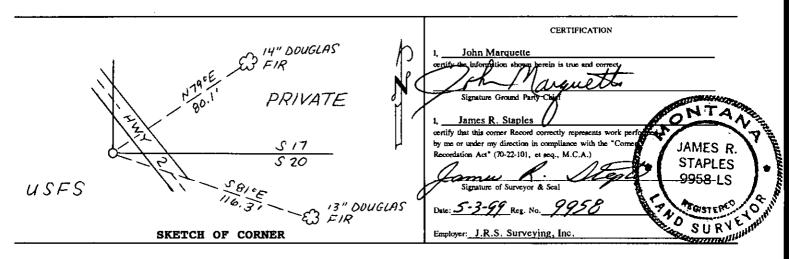

ρ . Λ	SE's Sec. 17		
Office of Clerk and Recorder, County of Jucob. This "corner			İ
record" was filed for record on			
was noted on the cross-index plat and is assigned page Noin		J.	
book No. 10336 (Mal M. Cumping By DeB			
councy official			

Cross Index No. N-8.25 T. 33N R. 34W PMM