4. She job or visitor, abow all proflected data which one leaf he shown in a cherch everyle, corner marking, topography ties, position of accessories, etc.

6. Certification must be signed and sealed by Registered Land Surveyor in State of Montana.

CERTIFIED CORNER RECORDATION

| Corner | 1/16 S21/28 | Т. | <u>33N</u> R. | 3/W · | P.M.M | ldncoln | County |
|--------|-------------|----|---------------|-------|-------|---------|--------|
| | | | | | | | |

RECORD: The original G.L.O. survey was conducted by Allen B. Benedict in 1905. The monument was originally set as part of HES survey No. 898 as conducted by Grant Higgins in 1922...."placed a small stone marked with a cross under a slate stone 24" x 10" x 9", 14 inches in the ground, marked 1/16 S on the north face and 11 HES 898 on the on the southeast face and a cross on top for the exact corner point, from which:

A cross on a 14" fir bears N 29 30' W, 36 links (23.76 feet), marked "1/16S 11 HES 898 BT."

Λ cross on a 6" fir bears N 19 30' E, 62 links (40.92 feet), marked "1/16S 11 HES 898 DT."


An 11"X10"X4" slate stone upright and firmly in the ground with "11 HES 898" on the south side of the stone (the north FOUND: side of the stone appears to have split off). A mound of stone lies southeast of the corner. No evidence of original B.T.'s found.

MAINTENANCE: Established 2 new bearing trees.

A 9" douglas fir bears N67 E, 14.40 feet, marked "WI/16 S21 BT"

A 6" douglas fir bears S83 W, 23.90 feet, marked "WI/16 S28 BT"

The balzes were painted red and a 6" red band was painted around each tree. Bearing tree tags were attached to the front. of each tree and Land Monument signs were attached to the back.

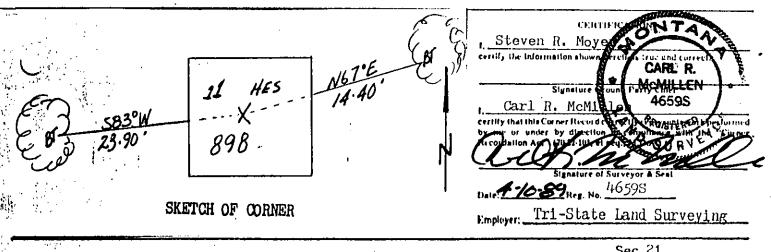

Lincoln Office of Clerk and Recorder, County of . . This "corner record" was filed for record on the ___ _ day of 19*8*,7 was noted on the cross-index plat and is assigned page No. _ book No. County Official corner this sheet

Cross below the R-10 #33N n 3/W pung