
- CERTIFIED CORNER RECORDATION -

P.M., MT 34N **26W** Lincoln County Corner 1/4 23 & 26

1894 G.L.O. Record by Frank L. Sizer et. al.: Set a post, 3.0 ft. long, 3.0 ins. square, 24 ins. in the I. ground, with "1/4 S" mkd. on N. face. Established two bearing trees.

1979 Certified Corner Recordation by Thomas C. Hill, 5612-S: No monument found and no accessories found. Set a 2 1/2 in. diam. brass cap, firmly in bedrock, mkd. as shown. Established two bearing trees.

1980 Certified Corner Recordation by Thomas C. Hill, 5612-S: No evidence of original monument and accessories found, found brass rock cap, stamped "5612S" as per C. of S. No. 748 & 750 and Corner Recodation Form, Book 1, Page 669. Position found to be in error, refer to correction C. of S. No. 748 & 750. At the corner point of the 1/4 sec. cor. of secs. 23 and 26, set by using single proportinate meassurement, a 2 1/2 in. diam., 30 ins. long aluminum pipe, 8 ins. in the ground with aluminum cap mkd. as shown, with a collar of stone.

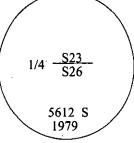

Established two new bearing trees.

Attached location poster to a 3.0 in. diam. larch, bears S36°W, 12.1 ft. dist. Attached bearing tree signs.

II. Found a 2 1/2 in. diam. brass cap, firmly set in bedrock, mkd. as shown.

from which:


A fir, 8 ins. diam., bears S69°E, 31.2 ft. dist., mkd. "1/4 S26 BT". (1980-record) A fallen pine, 8 ins. diam., bears N29°W, 33.7 ft. dist., mkd. "1/4 S23 BT". (1980-record)

III. Established one new bearing tree:

A pine, 9 ins. bears N45°E, 35.8 ft. dist., mkd. "1/4 S23 BT".

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East

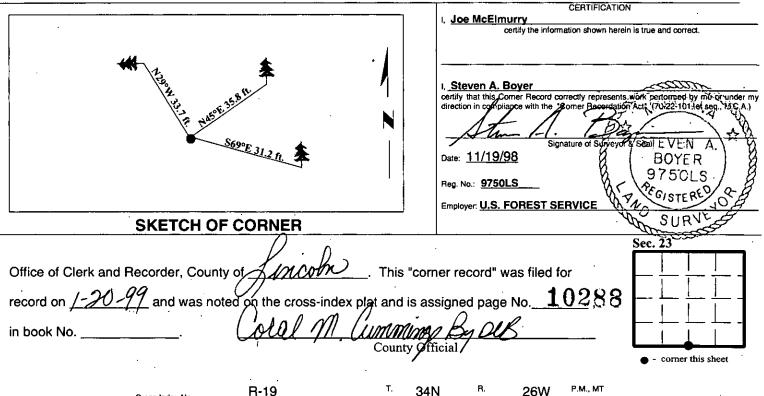

T34N R26W

5612 S

1980

. .