
- CERTIFIED CORNER RECORDATION -

Corner 1/4 Secs. 14 & 23 T. 34N R. 26W P.M., MT Lincoln County

- I. 1894 G.L.O. Record by Frank L. Sizer et. al.: Set a post, 3 ft. long, 3 ins. square, 24 ins. in the ground, for 1/4 sec. cor. mkd. "1/4 S" on N. Face. Established two bearing trees.
 - 1967 B.L.M. Remonumentation by Woodrow E. Damm et. al.: The 1/4 sec. cor. of secs. 14 and 23, as determined from the remains of the original N.W. bearing tree. At the corner point, set an iron post, 30 ins. long, 2 1/4 ins. diam., 24 ins. in the ground, with brass cap mkd. as shown.

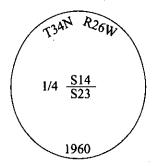

Established two new bearing trees and raise a mound of stone, 3 ft. diam., around the iron post.

1979 Certified Corner Recordation, Certificate of Survey No. 750, by Thomas C. Hill, 5612S: Found a 2 1/2" iron pipe with B.L.M. brass cap, mkd. as shown.

from which:

A 14" pine, bears S53°W, 18 lks.

A 15" pine, bears N50 1/2°W, 28 lks.

II. Found a 2 1/2 in. diam. pipe, firmly set, protruding 2 ins. above ground, with a 3 1/4 in. diam. B.L.M. brass cap mkd. as shown.

from which:

A down pine, 14 ins. diam., bears S53°W, 11.9 ft. dist., with visible scribe. (BLM-record) A pine stump, 12 ins. diam., bears N50°W, 18.5 ft. dist., no visible scribe. (BLM-record)


III. Established two new bearing trees:

A spruce, 10 ins. diam., bears S30°W, 16.3 ft. dist., mkd. "1/4 S23 BT".

A spruce, 9 ins. diam., bears N10°W, 24.9 ft. dist., mkd. "1/4 S14 BT".

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East

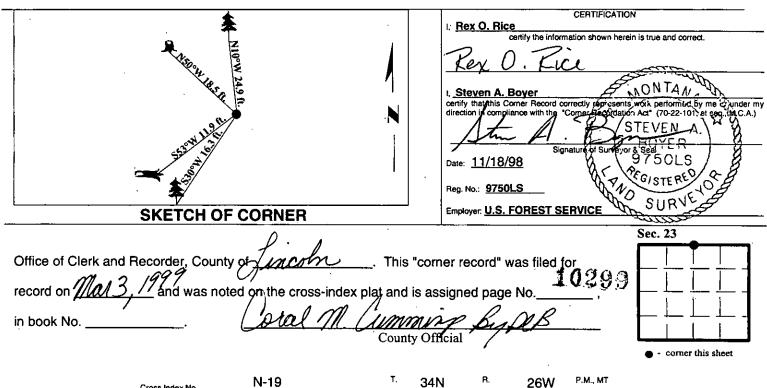

F.