
CERTIFIED CORNER RECORDATION

S1/16 Sec. 18 17 T. 34 N. R. 26 W. P.M.M. LINCOLN County

- Record: No previous record. Į.
- Π. No evidence found.
- At the position determined by survey, set a 3/4 in. diam. aluminum rod, 30 ins. long, 29 III. ins. in the ground, with a 3 1/4 in. diam. aluminum cap marked as shown:



The new bearing trees:

A fir, 8 ins. diam., bears S81°E, 22.1 ft. dist., marked S 1/16 S17 BT. A fir, 11 ins. diam., bears N45°W, 27.0 ft. dist., marked S 1/16 S18 BT. Location poster on a spruce, 22 ins. diam., bears N20°W, 23.8 ft. dist.

Set a 6 ft. galvanized steel guard post 3.0 ft. north and east, with Property Boundary and Land Survey Monument decals attached. Attached Bearing Tree and Land Survey Monument signs to the bearing trees. Attached brass disc directly above scribed "B" on both bearing trees. Disc reads LS 13769. Painted red bands around the bearing trees.


Date of Fieldwork: 9/20/2000

Survey crew: Linda Smith, Robin Glazier Magnetic declination: 18° East assumed

Equipment used: Hand compass and loggers tape

U.S. Forest Service, Supervisiors Office, 1101 Hwy. 2 West, Libby, MT 5992

CERTIE

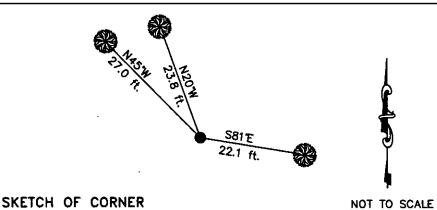

Date: 4/03/2003 Reg. No. 13769LS

Employer: U. S. Forest Service

Lincoln Office of Clerk and Recorder, County of _ _ This "corner record" was filed for record on $\frac{7-10-0.3}{}$


was noted on the cross—index plat and is assigned page No. book No. 168796

County Official

SHT 20/2

Cross Index No. M-05 T. 34N.R. 26W. P.M., MT

Adopted July 1, 1981, Mattena Board of Professional Engineers & Lan rveyors

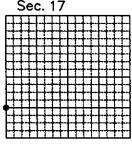

· corner this sheet

HOESE STREET

7-10-03

in illeunai

12 5796