## **CERTIFIED CORNER RECORDATION**

P.M., MT **HES 1132** 28 T. 34N 34W Lincoln County Corner Sec. R. Cor. 5

1922 Homestead Entry No. 1132 by J.F. Pfau: To listing cor. No. 4, mkd. and witnessed as described by I. the District Forester. I destroy the listing cor. and its accessories and in its place, establish cor. No. 5 of this survey, as follows: Place a small stone, mkd. with a cross (x) under a quartzite stone, 26x14x6 ins., 16 ins. in the ground, mkd. "5 HES 1132", on N face and a cross (x) on top for the exact corner point.

Established two bearing trees:

A cross (x) on a spruce tree, 12 ins. diam., bears N16°30'E, 37 lks. dist. A cross (x) on a spruce tree, 12 ins. diam., bears N86°E, 27 lks. dist.


Each bearing tree is blazed and scribed "5 HES 1132 BT". Raise a mound of earth, 4.0 ft. base, 2.0 ft. high, N of the corner.

- Found a 14x6 in. stone, protruding 6 ins. above the ground, firmly set, mkd. "5 HES 1132" on the N II. face, with an "x" on top. No evidence of bearing tree at N16°30'E, possible rotten sump at N86°E.
- III. Established two new bearing trees:

A cedar, 7 ins. diam., bears S41°E, 4.4 ft. dist., mkd. "5 HES 1132 BT". A cedar, 19 ins. diam., bears S45°W, 7.8 ft. dist., mkd. "5 HES 1132 BT".

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East.

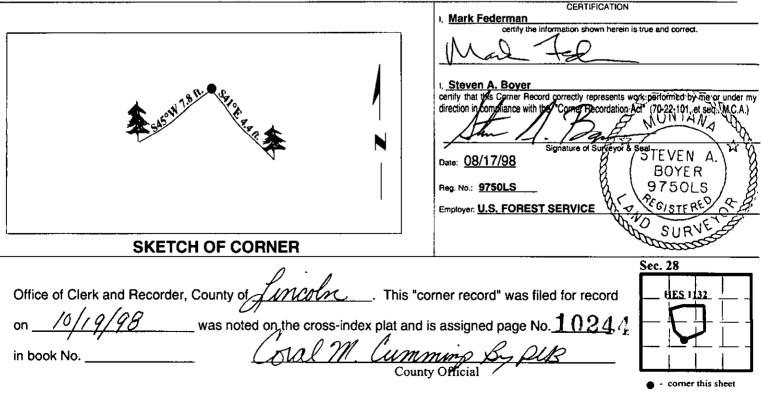

P.M., MT