1. Original and/or subsequent record used to evaluate the corner position.

2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.

3. Description of monument and accessories set to perpetuate the corner position.

- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories,
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: 2 HES 750, CC, Section 8

T.34N. R. 34W. P.M.M. <u>Lincoln</u> County

1917 GLO Record:

Set a small stone marked with a cross (x) under an iron post, 2 ins. dia., 36 ins. long, 24 ins. in the ground, with a brass cap marked "1917 CC 2HES 750" and a point on top for exact corner point from which:

A Larch, 10 ins. dia., bears N74°E, 33 lks. (21.8 ft.), marked with a cross and

scribed "2HES750BT"

A fir, 15 ins. dia., bears N16°W, 11 lks. (7.3 ft.), marked with a cross and

scribed "2HES750BT"

Raised a mound of earth, 4 ft. base and 2 ft. high, Northeast of corner.

2010 Found:

We find a 2-1/2 ins. brass cap on a 2 ins. dia. post rising 1.3 ft. above ground from which:

A rotted stump, 13 ins. dia., bears N13°30'W, 7.2 ft., with no visible evidence.

2010 Perpetuation:

Establish new bearing trees as follows:


A Douglas fir, 11 ins. dia., bears N28°30'W, 10.7 ft., scribed "2HES750CCRM1" A Cedar, 15 ins. dia., bears N3°30'W, 23.5 ft., scribed "2HES750CCRM2"

Bearing trees affixed with BT tags, LSM signs, snow blazed and painted red bands.

Steel spikes driven into BT's, side center at point of measurement.

We set a galvanized steel post N49°30'E, 0.8 ft. from monument, with LSM and USFS boundary decals.

See back side for corner exhibit

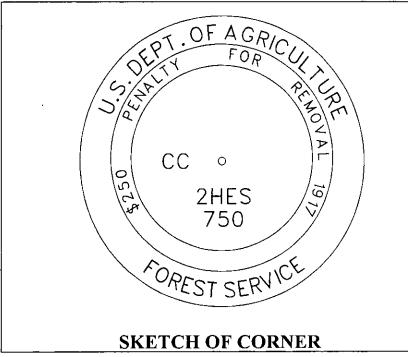

CERTIFICATION

I, Keith Brandt
certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Ken E Jenkins
certify that this Corner Record correctly 4 for represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101; et & 2.5 Million Signature of Surveyor & Seal Victorial Signature of Surveyor & Seal Victorial Reg. No. 9330 LS

Employer: Montana Northwest Company
P.O. Box 8777, Missoula, MT 59807
406-721-4033 Project No. 1617-10

					Sec. 8	3
Office of Clerk and Recorder, County of This "corner				\neg		
W C1 1 C	231918 BOOK	: CCR CCER'S	PAGE: 11861 Pages:	2		<u> </u>
record" was filed for record (STATE OF MONTANA LINCOLN COUNTY						
was noted on the cross-index	RECORDED: 03/31	/2011 10:36 KOI	: CCER'S	\vdash		
	TAMMY D. LAUER	CLERK AND BECOR	DER ,			
book No.	FEE: \$0.00	BY: Se en	DER SEE LEAGUE de BOX 8777 MISSOULA, MONTA	suly -	_	
	TO: MONTANA NORTH	WEST COMPANY P.O.	BOX 8777 🔭 NIBSOULA, MONTA	HA 🖢		
	(County Official	-			

