

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner: 3 HES 113, Section 17 T.34N. R. 34W. P.M.M. Lincoln County
4 HES 749, Section 17

- 1913 GLO Record: Set a quartzite stone, 22 ins. x 12 ins. x 10 ins., 12 ins. in the ground for Cor. No. 3, having a cross (x) cut in top at exact cor. point and "3HES113" out on Southwest face from which:
 A Jack pine, 7 ins. dia., bears S71°10'W, 0.16 chs. (10.6 ft.), marked with a cross and scribed "3HES113BT"
 A Jack pine, 12 ins. dia., bears N55°20'W, 1.51 chs. (99.7 ft.), marked with a cross and scribed "3HES113BT"
- 1917 GLO Record: Cor. No. 3 of HES No. 113, a quartzite stone 10 ins. x 12 ins., 10 ins. above ground. I adopt this cor. for Cor. No. 4 of this survey and mark the stone "4HES749" on the South east face from which:
 A Black pine, 8 ins. dia., bears N39°15'E, 66 lks (43.6 ft.), marked with a cross and scribed "4HES749BT"
 A Black pine, 9 ins. dia., bears N87°30'E, 18 lks (11.9 ft.), marked with a cross and scribed "4HES749BT"
- Raise a mound of earth, 4 ft. base, 2 ft. high, Southeast of corner.
- 2010 Found: We find a stone monument, 5 ins. x 7 ins., 0.4 ft. above ground, marked "HES749" on the East face. No evidence of BT's found.
- 2010 Perpetuation: Establish new bearing trees as follows:
 A Spruce, 14 ins. dia., bears N84°W, 30.7 ft., scribed "4HES749RM1"
 A Spruce, 17 ins. dia., bears N32°W, 10.3 ft., scribed "4HES749RM2"
 Bearing trees affixed with BT tags, LSM signs, snow blazed and painted red bands.
 Steel spikes driven into BT's, side center at point of measurement.
 We set a galvanized steel post North, 0.5 ft from monument, with LSM and USFS boundary decals.

See back side for corner exhibit


<p style="text-align: center; font-size: 1.2em;">Found Stone</p> <p style="text-align: center; font-weight: bold; margin-top: 20px;">SKETCH OF CORNER</p>	<p style="text-align: center; font-weight: bold;">CERTIFICATION</p> <p>I, <u>Keith Brandt</u> certify the information shown herein is true and correct. <i>Keith Brandt</i> Signature Ground Party Chief</p> <p>I, <u>Ken E Jenkins</u> certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., MCA). <i>Ken E Jenkins</i> Signature of Surveyor & Seal</p> <p>Date: <u>11/2010</u> Reg. No. <u>9330 LS</u> Employer: <u>Montana Northwest Company</u> <u>P.O. Box 8777, Missoula, MT 59807</u> <u>406-721-4033 Project No.1617-10</u></p>
---	---

Sec. 17

Office of Clerk and Recorder, County of _____ This "corner record" was filed for record on _____
 was noted on the cross-index _____
 book No. _____

231924 BOOK: CCR CC&R'S PAGE: 11867 Pages: 2
 STATE OF MONTANA LINCOLN COUNTY
 RECORDED: 03/31/2011 10:44 KOI: CC&R'S
 TAMMY D. LAUER CLERK AND RECORDER
 FEE: \$0.00 BY: *Tammy D. Lauer*
 TO: MONTANA NORTHWEST COMPANY P.O. BOX 8777, MISSOULA, MONTANA

County Official

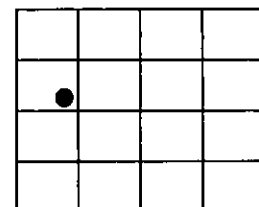

Cross Index No. 3HES 113 T. 34N R. 34W PMM
4HES 749

● - Corner this sheet

- Corner this sheet

STATE LINE
MONUMENT
NO. 28

N.F.S.L.

2 & CC

UNSURVEYED SEC. 8

IDAHO
MONTANA

N.F.S.L.

HES 750
PRIVATE

UNSURVEYED SEC. 17

STATE LINE
MONUMENT
NO. 29 & COR.
1 HES 750

STATE LINE

HES 713
PRIVATE

N.F.S.L.

HES 749
PRIVATE

2 & CC

N.F.S.L.

N.F.S.L.

UNSURVEYED SEC. 20

STATE LINE
MONUMENT
NO. 30