INSTRUCTIONS

- Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated
- corners.

 3. Description of monument and accessories set to perpetuate the corner position.

 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.

 5. Certification must be signed and sealed by
- topography uses, position of accessories, etc.


 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

T. ______ R. _____ P.M.M. 6 of HES 844 Lincoln Corner. County

1917 HES original record by E. R. Johnson: "Cor. No. 6 of this survey as follows: Set a small stone, marked with a cross (X) under an iron post 2 ins. diam., 36 ins. long, 24 ins. in the ground, with a brass cap marked:



and a point on top for the exact corner point, from which:

A cross (X) on a white pine tree, 20 ins. diam., bears $N.75^{\circ}30'W$., 36 lks. dist. A cross (X) on a white pine tree, 15 ins. diam., bears $N.48^{\circ}30'E$., 35 lks. dist. each blazed and scribed 6 HES 844 BT.

Raise a mound of stone 4 ft. base, 2 ft. high, NE. of corner."


- II. Found a 2 ins. diam. iron pipe, protruding 4 ins. out of the ground, with a Forest Service brass cap, mkd. as shown above. No bearing trees found, due to logging road.
- III. Established two new bearing trees:

A grand fir, 12 ins. diam., bears N.6 W., 17.7 ft. dist., mkd. 6 HES 844 BT. A larch, 18 ins. diam., bears 8.82° E., 5.0 ft. dist., mkd. 6 HES 844 BT.

Painted red bands around the bearing trees and attached "Land Survey Monument" and "Bearing Tree" signs.


Set a galvanized steel guard post with "Land Survey Marker" and "Property Boundary" decals, N.59 E., 3 ft. dist. from corner.

Magnetic declination: 20° East

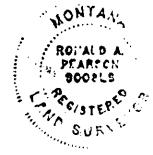

12" LARGH Kevin A. Todd certify the information shown herein is true and correct Ronald A. Pearson certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the Recordation Act" (70-22-101, et seq., M.C.A.) S.A.) 11/26/91 Reg. No. 9008 LS U.S. FOREST SERVICE **SKETCH OF CORNER** Office of Clerk and Recorder, County of . This "corner

an 16,1992 record" was filed for record on _ was noted on the cross-index plat and is assigned page No. book No. . 6 HES 844

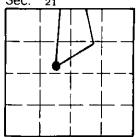

· corner this sheet

PMM