

INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner 5 of HES 735 T. 34 N. R. 33 W. P.M.M. Lincoln County

- I. 1917 HES 735 record by Elmer R. Johnson: "Set for Cor. No. 5, a small stone marked with a cross(X) under a shale stone 24x8x5 ins., 14 ins. in the ground, marked 5 H.E.S. 735 on N face and a cross (x) on top for exact corner point."

from which:

- A cross (x) on a larch tree 30 ins. diam., bears $S89^{\circ}45'E.$, 169 lks. (111.54 ft.) dist.
 A cross (x) on a larch tree 24 ins. diam., bears $N44^{\circ}E.$, 183 lks. (120.74 ft.) dist; each blazed and scribed 5 HES 735 B.T.
 Raise a mound of earth 4 ft. base, 2 ft. high, North of the corner.

- II. Found a firmly set stone 9x5 ins., protruding 10 ins. out of the ground, mkd. 5 HES 735 on North face.

from which:


- A larch stump, 34 ins. diam., bears East, 112 ft. dist. marked B.T.
 A larch stump, 40 ins. diam., bears $N45^{\circ}E.$, 120 ft. dist. healed face.
 A dead larch, 9 ins. diam., bears $N24^{\circ}E.$, 6.9 ft. dist. healed face. (no record)

- III. Established two new bearing trees:

- A larch, 12 ins. diam., bears $S51^{\circ}E.$, 16.4 ft. dist., mkd. 5 HES 735 B.T.
 A fir, 11 ins. diam., bears $S86^{\circ}W.$, 6.7 ft. dist., mkd. 5 HES 735 B.T.

Painted red bands around the bearing trees and attached "Land Survey Monument" and "Bearing Tree" signs. Set a galvanized steel gaurd post with "Land Survey Marker" and "Property Boundary" decals, $S85^{\circ}W.$, 3 ft.

Magnetic declination: 20° East

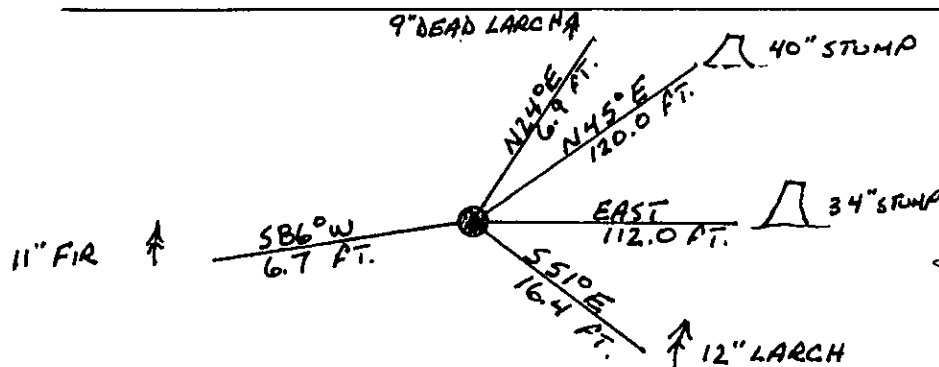

SKETCH OF CORNER

CERTIFICATION

I, Kevin A. Todd
 certify the information shown herein is true and correct.

Kevin A. Todd
 Signature Ground Party Chief

I, Ronald A. Pearson
 certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Ronald A. Pearson
 Signature of Surveyor & Seal

Date: 11/16/92 Reg. No. 9008LS

Employer: U.S. FOREST SERVICE

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on 12-7-92 was noted on the cross-index plat and is assigned page No. 5127, in book No. Coral M. Cummings

County Official


5 HES 735

34 N

33W

Cross Index No. _____ T. _____ R. _____ PMM

Sec. 26

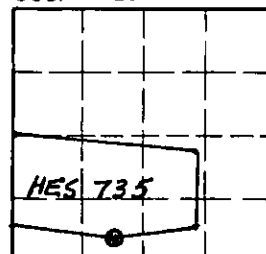

• - corner this sheet