

INSTRUCTIONS

1. Original and subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch or corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Registered Land Surveyor in State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner Cor. No. 3 H.E.S. 337 T. 35 N. R. 27 W. P.M.M. Lincoln County
(Located in Sec. 2)

ORIGINAL RECORD U.S.D.A. 1915

Cor. No. 3 and closing corner on line between Secs. 1 and 2.

Set for Cor. No. 3, a limestone 24x10x5 ins., 14 ins. in the ground, mkd. CC 14 HES on N.W. face, and a cross (x) on top for the exact corner point, from which:

A cross (x) on a fir, 8 ins. diam., bears S 70° 30' E, 3 lks. dist.

A cross (x) on a fir, 10 ins. diam., bears S 65° 30' W, 111 lks. dist.

each blazed and scribed 3 HES 337 BT. Raise a mound of earth, 4 ft. base, 2 ft. high, N.W. of corner.

EVIDENCE FOUND

Found a limestone, 10x5 ins. 6 ins. above the ground, mkd. CC 3 HES 337 on the N.W. face witnessed by an original bearing tree: 5 HES 782 on the S.E. face

A fir, 18 ins. diam., bears S 52° E, (S 70° 30' E Rec.), 2.6 ft. dist., with scribing visible.

The original bearing tree located to the S.W. was searched for and no evidence found.

CORNER PERPETUATION

At the corner point; Set an aluminum pipe, 2 1/2 ins. in diam., 30 ins. long, 24 ins. in the ground, with a 3 1/4 in. aluminum cap, mkd.

T35N R27W

S 70° 30' E

4739 S

HES 337


3 CC

1987

from which a new bearing tree:

A fir, 15 ins. in diam., bears S 22° W, 27.5 ft. dist., mkd. 3 HES 337 BT.

Set a galvanized steel guard post 3 ft. N.W. of the aluminum monument, with a Property Boundary decal and a Survey Marker decal. Painted red bands around the bearing trees and painted the scribing and blazing. Attached bearing tree signs and attached Land Survey Monument signs.

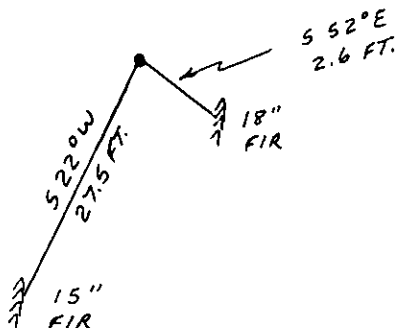

DECL. 21° E

SKETCH OF CORNER

CERTIFICATION

I, _____
certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Philip A. Helps
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.D.A.)

Signature of Surveyor & Seal

Date: 9/87 Reg. No. 4739 S


Employer: F & H Land Surveying, Whitefish

Office of Clerk and Recorder, County of Lincoln. This "corner record" was filed for record on the October 6 day of 1987, was noted on the cross-index plat and is assigned page No. 3664, in book No. _____

Janet BF Segel by Eric Buckhoff
County Official Deputy

Cross Index No. _____ T. 35 N. R. 27 W. P.M.M.

Sec. 2

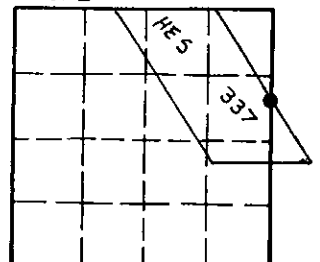

• corner this sheet