INSTRUCTIONS

- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated
- corners.


 3. Description of monument and accessories set to perpetuate the corner position.

 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
- Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

1/4 of Secs. 12 and 13 ___ T. ____35 N. . R. ___27 W. P.M.M. __ Lincoln Corner _ _County 1913 G.L.O. original record by L. Lyman et al: Set a stone monument with two bearing trees. 1961 BLM remonumentation by David R. Cunningham et al: "The 1/4 sec. cor. of secs. 12 and 13, monumented with a limestone, 14x10x8 ins., firmly set and mkd. 1/4 on the N. face, and witnessed

At the corner point, set an iron post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, in concrete, with brass cap mkd.



from which

The remains of the original bearing trees: A dead fir, 8 ins. diam., bears S3 1/4 W, 47 lks. dist., mkd. 1/4 S13 BT. (Record) A dead fir. 6 ins. diam., bears N35 1/2 W, 8 lks. dist., mkd. 1/4 S12 BT.

(Record N37 1/2°W, 8 1ks.)

by the remains of the original bearing trees.

The new bearing trees:

A fir, 9 ins. diam., bears N36 1/2 E, 44 lks. dist., mkd. 1/4 S12 BT. A fir, 9 ins. diam., bears S29 E, 94 lks. dist., mkd. 1/4 S13 BT.

Bury the original stone, alongside of the iron post."

II. Found a 2 1/2 ins. diam. pipe, 3 ins. out of the ground, with BLM brass cap mkd. as shown, from which


A fir, 15 ins. diam., bears 826° E, 62.1 ft. (94 lks.) dist., no visible scribing. A tree stump, 8 ins. diam., bears N37 W, 5.1 ft. (8 lks.) dist., no visible scribing.

III. Establish one new bearing tree:

A fir, 19 ins. diam., bears N63 W, 8.1 ft. dist., mkd. 1/4 S12 BT.

Painted red bands around the bearing trees and attached Land Survey Monument and Bearing Tree signs. Set a 6 ft. galvanized steel guard post with Land Survey Marker and Property Boundary decals, East, 3.7 ft.

Magnetic Declination: 20° East

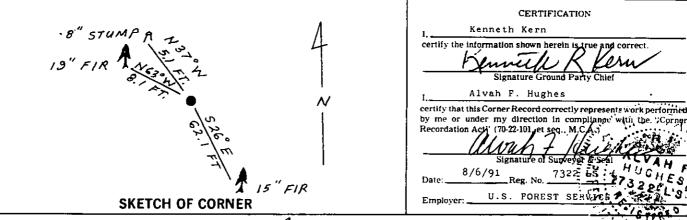

SKETCH OF CORNER		20
Office of Clerk and Recorder, County of	Sec. 13'/	<u> </u>
record" was filed for record on	, 1991	
was noted on the cross-index plat and is assigned page		
book No Oral M Our	umings by Bill Breefoff	
Cross Index No	3 T. 35 N R. 27 W PMM • - corner this s	—J heet