INSTRUCTIONS

- Original and/or subsequent record used to evaluate the corner position.
 Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- Description of monument and accessories set to perpetuate the corner position.
 Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
- 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

 6. Fill in Cross Index & Section Diagram at bottom of sheet.

12 of HES 350

CERTIFIED CORNER RECORDATION

9 of HES 348

35 N., 31 W.,

1915 HES 350 record by Fred. E. Thieme:" Set for Cor. No. 12, a small stone marked with a cross(x) under a quartzite stone 30x6x6 ins., 20 isn. in the ground, marked 12 HES 350 on NW face, and a cross on top for the exact corner point, from which

A cross(x) on a fir, 24 ins. diam., bears $8^{\circ}34$ 'E, 22 lks.(14.52 ft.) dist. A cross(x) on a lodgepole pine, 10 ins. diam., bears 875° 00'W, 38 lks.(25.08 ft.) dist. Each blazed and scribed 12 HES 350 BT.

Raise a mound of earth 4 ft. base, 2 ft. high, NW of corner.


1915 HES 348 record by Fred E. Thieme: "To Cor. No. 9, identical with Cor. No. 12 of unapproved HES No. 350, a quartzite stone 10x6x6 ins. above ground. I mark this stone for Cor. No. 9, 9 HES 348 on SW face." Bearing trees used for HES 350 mkd. 9 HES 348 BT.

Corner.

A douglas fir, 31 ins. diam., mkd. 9 HES 348 BT, HES.(Original SE BT)

Corner position falls in an area disturbed by the building of a pond.

III. At the position determined by bearing-distance intersection from found record bearing tree, set a 3/4 in. diam., 30 ins. long alum. rod, 24 ins. in the ground, with alum. cap mkd. as shown




Established one new bearing tree:

A subalpine fir, 8 ins. diam., bears $S88^{\circ}$ E, 38.7 ft. dist., mkd. 9 HES 348 BT.

Painted red bands around the bearing trees and attached "Land Survey Monument" and "Bearing Tree" signs.

Set a galvanized steel guard post with "Land Survey Marker" and "Property Boundary" decals, South, 3 ft. Magnetic declination: 20 East

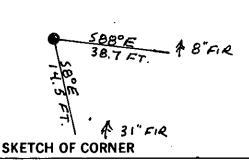

CERTIFICATION AND THE MONTAN Kevin A. Todd is true and correct. n herein is tra PFARCOL Ronald A. certify that this Corner Record corrections by me or under my direction in comp Recordation Act" (70-22-10), et see M.C. M.C.A. SURVE

12/23/91 9008 LS Reg. No. U.S. FOREST SERVICE Employer: ,

Office of Clerk and Recorder, County of Luccold . This "corner record" was filed for record on was noted on the cross-index plat and is assigned page No. book No. _ u 9620

348

Sec.

30

corner this sheet

PMM

9 HES 348