

## INSTRUCTIONS

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography lies, position of accessories, etc.
5. Certification must be signed and sealed by Registered Land Surveyor in State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

Corner No. 8 H.E.S. No. 1059 T. 35 N., R. 33 W., P.M.M. Lincoln County  
 {Unsurveyed Section 30<sup>±</sup>} Date of Work: September, 1983

## 1. Original Record {June, 1921}

Place a small stone, marked with a cross {x} under a sandstone, 24 x 9 x 8 ins., 14 ins. in the ground, marked 8 HES 1059 on W. face and a cross {x} on top for the exact corner point, from which:

A cross {x} on a cedar tree, 5 ins. dia., bears S. 68° 18' W., 9 lks. dist.

A cross {x} on a balsam fir tree, 5 ins. dia., bears N. 32° 20' E., 7 lks. dist.

Each blazed and scribed: 8 HES 1059 BT

Raise a mound of earth and stone, 4 ft. base, 2 ft. high, W. of Corner.

## 2. Evidence found {September, 1983}

Found a 9 x 8 inch stone, approx. 2 inches underground, which we left exposed approx. 2 inches above ground, marked 8 HES 1059 on W. face and a cross {x} on top for the exact corner point, from which:

A fragment of the original cedar tree, 5 ins. dia., bears S. 68° 18' W., 9 lks. dist., with visible scribing "T" at the base of the 6 in. high, 4 in. across, 1 in. thick fragment.

## 3. Perpetuation {September, 1983}


Painted Original Stone Monument marking Corner No. 8 HES No. 1059 red, drive 3 foot lath alongside with identifying information, from which:

A cedar tree, 5 ins. dia., bears N. 85° W., 27.2 ft. dist.

A cedar tree, 21 ins. dia., bears S. 24° W., 29.5 ft. dist.

Each marked with a cross {x} above a blaze scribed: 8 HES 1059 BT, cross and face of blaze of each painted red with a red ring painted around the trees at cross {x}

Also painted the original witness tree fragment red and tied blue flagging around it.

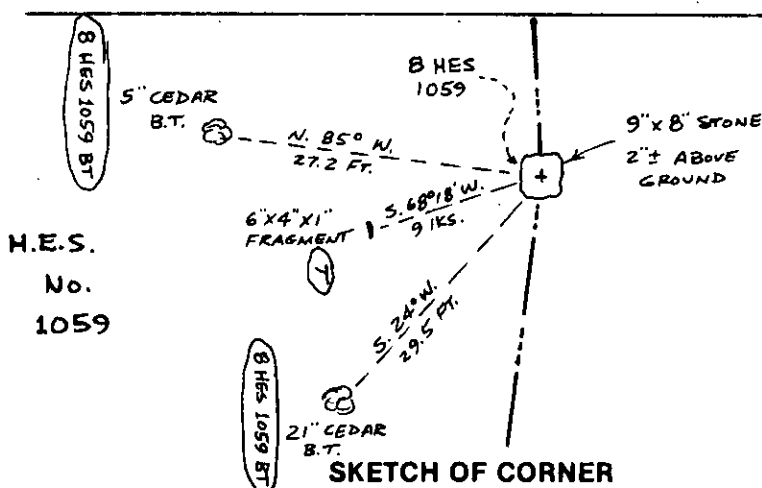

## CERTIFICATION

I, L.A. Dolezal

certify the information shown herein is true and correct.

L.A. Dolezal  
 Signature of Ground Party Chief

I, Melvin D. Lauterbach

certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22301, et seq., M.C.A.)

Melvin D. Lauterbach  
 Signature of Surveyor & Seal

Date: 9-30-83 Reg. No. 42325

Employer: Kootenai Engineering, Inc.

Office of Clerk and Recorder, County of LINCOLN. This "corner record" ± Sec. 30-T35N-R33W-PMM was filed for record on the 3rd day of OCT. 19 83, was noted on the cross-index plat and is assigned page No. 2352, in book No. Janet E. Sigel by Betty L. Conice

County Official Deputy

Cross Index No. 35

R. 33 PMM

UNSURVEYED	
ICOR No. 8	H.E.S. No. 1059
(APPROX. ONLY)	
-30-	

• corner this sheet