

# CERTIFIED CORNER RECORDATION

Corner Cor 2 of HES 786 T. 35N R. 25W P.M.M. Lincoln County

1917 HES Original Record by R.E. Maurer:

Set a small stone, marked with an X under a granite stone 26x14x9 ins., 16 ins. in the ground, mkd. 2 HES 786 on the SE face and a cross on top for the exact corner point.  
Two bearing trees and a mound of earth 4 ft. base, 2 ft. high, SE of corner.

1960 BLM Resurvey by D. Cunningham:

Found: a granite stone, 24x12x9 ins. set and mkd. as above;  
A Spruce Stump, 14 ins. in diam. bears N67°32'E, 15 lks. dist. mkd. 2 HES 786 BT.  
A Cottonwood, 13 ins. in diam. bears N27 3/4°W, 29 lks. dist. marking overgrown.  
Set:  
An Iron Post, 30 ins. long, 2 1/2 ins. diam. 26 ins. in the ground, in concrete with Brass Cap mkd.  
A Spruce, 6 ins. in diam. bears N 58 1/4°E, 19 lks. dist., mkd. 2 HES 786 BT.  
A Fir, 9 ins. in diam. bears N10 3/4°W, 43 lks. dist., mkd. 2 HES 786 BT;  
Bury the original stone alongside and raise a mound of stone, 3 ft. base, 2 1/2 ft. high, SE of IP.

1991 Resurvey by Alvah F. Hughes:

Found: A BLM Brass Cap on 2 1/2 ins. diam. Iron pipe, 4 ins. above ground with rock collar,  
A Rotten Remains, bears N67°E, 9.9 ft. dist.;  
A Spruce, 14 ins. in diam. bears N58°E, 11.9 ft. dist, mkd, 2 HES 786 BT;  
A Cottonwood stump, bears N30°W, 19.0 ft. dist., visible ax marks.  
A Fir, 16 ins. in diam. bears N11°W, 28.4 ft. dist., healed face.


Set:

A 6 ft. galvanized steel post with LSM & PB decals, N46°E, 3 ft. dist. from corner.


2. Found:

A BLM Brass monument, 3 1/4 ins. in diam., 6 ins. out of ground surrounded by a mound of stone, mkd. as shown;  
A Spruce, 15 ins. in diam., bears N58°E, 11.90 ft. dist., partially healed face, illegible scribing visible;  
A Douglas Fir, 17 ins. in diam., bears N11°W, 28.40 ft. dist., with healed face;  
A Steel post, lying on ground by corner with LSM & Boundary tags.

3. Restacked and painted a stones around monument. Changed Steel Post from N46°E, 3 ft. dist. to East, 3 ft. dist., it was placed on wrong bearing for line.  
Repainted blazes and rings on all BTs.

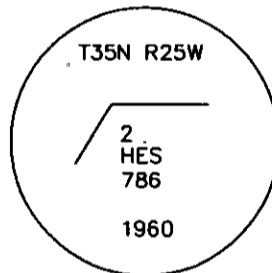

MAGNETIC DECLINATION - 16° EAST

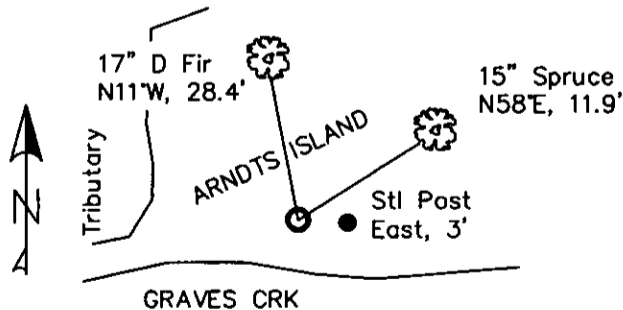

SKETCH OF CORNER

CERTIFICATION

I, CURT HECKROTH  
certify the information herein to be true and correct.

*Curt Heckroth*

I, LAWRENCE A. GLAHE  
certify that the Corner Record herein represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (MCA 2-2-101, et seq. M.C.A.)

*Lawrence A. Glahe*

9748 LS  
LAND SURVEYOR

Date: 11-10-10 9748 LS  
Employer: GLAHE & ASSOC., INC.

Office of Clerk and Recorder. County of Lincoln This "corner  
229670 BOOK: CCR CC&R'S PAGE: 11640 Pages: 1  
record" was filed for record STATE OF MONTANA LINCOLN COUNTY  
was noted on the cross-index RECORDED: 11/16/2010 9:10 KOI: CC&R'S  
book No.                      TAMMY D. LAUER CLERK AND RECORDER  
FEE: \$0.00 BY *Tammy D. Lauer*  
TO: GLAHE & ASSOC., INC. P.O. BOX 1863, SANDPOINT, ID. 83860,  
2 HES 786  
Cross Index No. 5018 T. 35N R. 25W PMM

Sec. 5

		●	



*[The text in this section is extremely faint and illegible due to low contrast and scan quality. It appears to be several paragraphs of a document.]*

*[Faint handwritten or stamped text, possibly a signature or date.]*

*[Faint handwritten or stamped text, possibly a signature or date.]*

*[Faint text at the bottom of the page, possibly a footer or concluding remarks.]*