

CERTIFIED CORNER RECORDATION

Corner Cor 11 of HES 787 T. 35N R. 25W P.M.M. Lincoln County

1917 HES Original Record by R.E. Maurer:

Set a small stone, marked with an X under a granite stone 24x6x6 ins., 14 ins. in the ground, mkd. 11 HES 787 on the NE face and a cross on top for the exact corner point.
Two bearing trees and a mound of earth 4 ft. base, 2 ft. high, NE of corner.

1960 BLM Resurvey by D. Cunningham:

Found:

A Granite Stone, 14x10x6 ins. set and mkd. as above;
A Fir, 16 ins. in diam., bears N2¼°E, 28 lks. dist. markings overgrown;
A Fir, 11 ins. in diam. bears S50°42'W, 2 lks. dist. mkd. 11 HES 787 BT;
Bury the original stone alongside and raise a mound of stone, 3 ft. base, 2 ft. high, NE of the IP.
Set:
A Fir, 8 ins. in diam. bears N8¼°W, 48 lks. dist. mkd. 11 HES 787 BT;

1991 Resurvey by Alvah F. Hughes:

Found:

A BLM Brass cap on on 2½ ins. diam. Iron pipe, 2" above ground with rock mound, mkd. as shown;
A Fir, 25 ins. in diam. bears N4°E, 19.3 ft. dist., healed face.
A Fir, 13 ins. in diam. bears S51°W, 1.3 ft. dist., healed face.
A Fir, 13 ins. in diam. bears N8°W, 38.1 ft. dist., healed face.


Set:

A 6 ft. galvanized steel guard post with LSM & PB decals, North 3 ft. dist.


2. Found

A BLM Brass Monument, ¾ ins. in diam., 2 ins. out of ground with a mound of stone, NE 1ft. dist.
A Douglas Fir, 28 ins. in diam., bears S4°E, 19.30 ft. dist., (record N4°E 1991), with healed face;
A Douglas Fir, 15 ins. in diam., bears S51°W, 1.30 ft. dist., with healed face;
A Douglas Fir, 15 ins. in diam., bears N8°W, 31.40 ft. dist., (record 38.10 ft. 1991), healed face;
Missing steel post of record.

3. No painting done at request of adjacent land owner, house faces corner; Placed Steel Post with LSM & Boundary tags, East, 3 ft. dist.

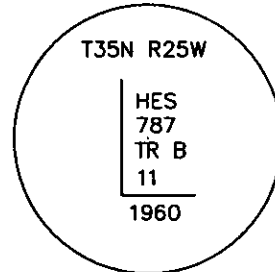

MAGNETIC DECLINATION - 16° EAST

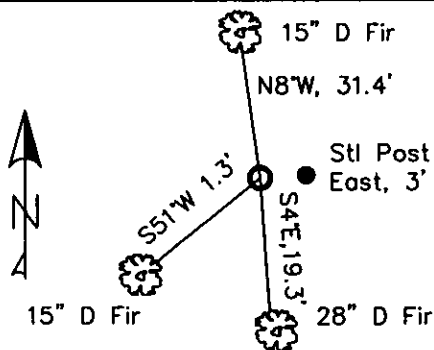

SKETCH OF CORNER

CERTIFICATION

I, CURT HECKROTH
certify the information shown here is true and correct.

Curt Heckroth
Surveyor Ground Party (Signature)

I, LAWRENCE A. GLAHE
certify that this Corner Recordation was performed by me or under my direction in compliance with the "Corner Recordation Act" (P.L. 86-601, et seq. M.C.A.)

L. Glahe
Registered Professional Engineer and Land Surveyor

Date: 11-10-10 9748 LS

Employer: GLAHE & ASSOC., INC.

Office of Clerk and Recorder, Lincoln, Montana
229691 BOOK: CCR CC&R'S PAGE: 11661 Pages: 1
record" was filed for record o STATE OF MONTANA LINCOLN COUNTY
was noted on the cross-index: RECORDED: 11/16/2010 9:31 KOI: CC&R'S
book No. TAMMY D. LAUER CLERK AND RECORDER
FEE: \$0.00 BY: *Tammy D. Lauer*
TO: GLAHE & ASSOC., INC. P.O. BOX 1863, SANDPOINT, ID. 83860,

11 HES 787

Cross Index No. 5015 T. 35N R. 25W PMM

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors.

Sec. 5

● corner this sheet

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..

... ..
... ..
... ..