## CERTIFIED CORNER RECORDATION

Corner CS 1/16 Sec. 15 T 36 N. R. 26 W. P.M.M. LINCOLN County

- I. Record: 1997 Certificate of Survey #2523 by Dawn Marquardt: Subdivides the SE 1/4 section 15 and establishes the CS 1/16. A 5/8 in. diam. x 24 in. long rebar with a yellow plastic cap stamped 7328S was set at the position for the CS 1/16.
  - 2000 Certificate of Survey #3061 by Dawn Marquardt: References the CS 1/16.
  - 2001 Final Subdivision Plat Colgrove #1. #6374 by Dawn Marquardt: References the CS 1/16.
  - 2002 Subdivision Plat Colgrove #2, #6422 by Dawn Marquardt: References the CS 1/16.
- II. Found a 5/8 in. diam. rebar, 6 ins. above ground, with a yellow plastic cap marked MARQUARDT 7328S.
- III. Accept the position of the found Marquardt rebar as the true position for the CS 1/16. Removed the yellow plastic cap and replaced it with a 3 1/4 in. diam. aluminum cap marked as shown:

T36N R26W C S 1/16 S15 C 13769LS 2002

The new bearing trees:

A fir, 7 ins. diam., N7°E, 7.5 ft., marked X BT. A fir, 11 ins. diam., N69°W, 9.6 ft., marked CS 1/16 S15 BT.


Set a 6 ft. galvanized steel guard post 3.0 ft. east and west, with Property Boundary and Land Survey Monument decals attached. Attached Bearing Tree and Land Survey Monument signs to the bearing trees. Painted red bands around the bearing trees.

Date of Fieldwork: 11/7/2002

Survey crew: Steve Boyer, Tom Hommel Magnetic declination: 20° East assumed

Equipment used: Hand compass and loggers tape

U.S. Forest Service, Supervisiors Office, 1101 Hwy. 2 West, Libby, MT 59923 (406) 293-6211

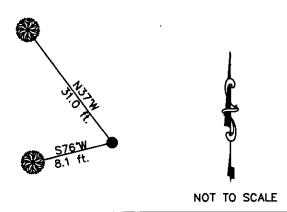

Steven A. Boyer 97 ot S.

Certify the information shows Benefic is true and correct.

ROSER O.

Signature orbund party SMEEN

ROSER O.

ROSER O.

ROSER O.

ROSER O.

ROSER O.

Signature orbund party SMEEN

certify that this Corner Redard correctly represents work performed by me or under my disection in certification work performed by me or under my disection in certification work performed by me or under my disection in certification work performed by me or under my disection in certification work performed by me or under my disection in certification.

Signature of Surveyor & Seal

Date: 11/07/2002 Reg. No. 13769LS

Employer: U. S. Forest Service

SKETCH OF CORNER

-

Office of Clerk and Recorder, County of Lincoln


This "corner record" was filed for record on 30,203

was noted on the cross-index plat and is assigned page No. 1058.9 in book No.

County Official

Cross Index No. <u>M-15</u> T. <u>36N.</u> R. <u>26W.</u> P.M., MT

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

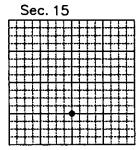

· corner this sheet