CERTIFIED CORNER RECORDATION

Corner	1/4	S31	32	T_	36	N.	_R.	26	<u>W.</u>	P.M.M	LINCOLN	County
--------	-----	-----	----	----	----	----	-----	----	-----------	-------	---------	--------

1893 Original Subdivision and Meanders by Peter M. Cardell and Abram L. Jaqueth: Set a psot 3 ft. long, 3 ins. square, 24 ins. in the ground for 1/4 sec. cor., marked 1/4 S on W. face, from which: A fir, 14 ins. diam, bears N18°E, 47 lks. dist., marked. 1/4 S BT.

A fir, 16 ins. diam, bears S63'W, 43 lks. dist., mkd. 1/4 S BT.

1959 B.L.M. Remonumentation by David R. Cunningham and William E. Stephens: The 1/4 sec. cor. of secs. 31 and 32, monumented with a disintegrated wooden post, firmly set in the ground, and witnessed by the remains of the original bearing trees. At the corner point, set an iron post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, in concrete, with barass cap mkd.

from which the remains of the original bearing trees:

A stump, 23 ins. diam, bears N18°E, 47 lks. dist., visible marks BT. A stump, 26 ins. diam, bears S63°W, 43 lks. dist., mkd. 1/4 S BT.

T36N R26V 1/4 S31 S32 1959

the new bearing trees

A fir, 9 ins. diam, bears N75 1/4°E, 36 lks. dist., mkd 1/4 S32 BT. A pine, 6 ins. diam, bears S33 $1/4^{\circ}W$, 30 lks. dist., mkd. 1/4 S31 BT. Raise a mond of stone, 3 ft. base, 2 ft. high. W. of the iron post.

1998 Certified Corner Recordation by Dayton D. Nelson, MT Reg. No. 3897ES; Corner was in a rock pile at the intersection of an existing fence and remnants of an old fence. The pile was inside a roll of woven wire from the old fence and had been there for several years. Original notes call for a limestone 12"x10"x6", 8" in the ground, marked 1-4 on W. face with pits 18"x18"x12", N. & S. of stone, 5 1/2 ft. dist. and raised a mound of earth 1 1/2 ft. high, 3 1/2 ft. base alongside. Orig. stone could not be ident., but location of corner by survey from south and north sec. corners agreed with record location. Corner had been used in earlier survey. Set a 5/8" rebar in rock pile, 14" the ground at corner location.

Found a 2 1/2 in. diam. iron pipe, 3 ins. above the ground, firmly set with a 3 1/4 in. diam. B.L.M. brass cap marked as shown below, from which:

A pine, 6 ins. diam, bears S33 1/4W, 30 lks. dist., mkd. 1/4 S31 BT.

III. Painted red the scribed faces and 6 in. bands on the bearing trees. Attached Land Survey Monument and Bearing Tree signs. Set a 6 ft. galvanized steel guard post 3 ft. West and South, with Land Survey Monument and Property Boundary decals attached.

Date of Fieldwork: 11/6/2007

TO: FILED .


Survey crew: Steve Boyer, Tom Hommel Magnetic declination: 20° East assumed

Equipment used: Hand compass and loggers tape

Cross Index No.

Adopted July 1, 1981, Montana Board of Professional Engineers & Land Surveyors

U.S. Forest Service, Supervisiors Office, 1101 Hwy. 2 West, Libby, MT 59923 (406) 293-6211

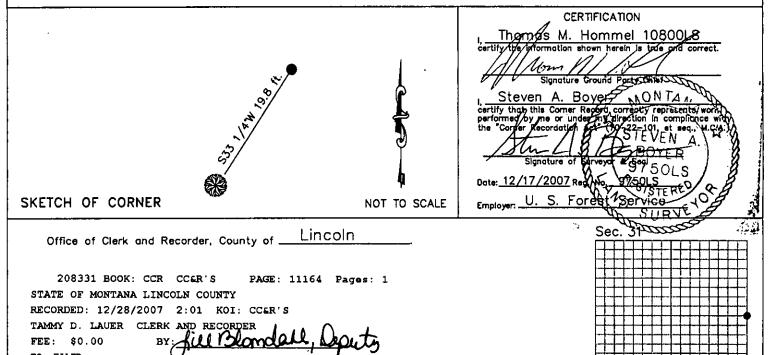

<u>т. 36N.</u>r. <u>26W.</u> р.м., мт

corner this sheet