CERTIFIED CORNER RECORDATION

Corner 1/4 Sec. 1/2 T. 36N R. 31W P.M., MT Lincoln County

I. 1931 original G.L.O. record by Ranney Y. Lyman: Set an iron post, 3 ft. long, 1 in. diam., 28 ins. in the ground, with a brass cap mkd:

1931

1/4
S2 S1

from which:

A tamarack, 8 ins. diam., bears N33° 30'E, 10 lks. dist., mkd. "1/4 S1 BT". A tamarack, 14 ins. diam., bears N76° 0'W, 36 lks. dist., mkd. "1/4 S2 BT".

II. Original monument destroyed as the position lies in a skid road. Found remains of original bearing trees:

A fir stump, 13 ins. diam., with scribing "1 BT" visible. (Rec. tamarack, N33° 30'E) A larch stump, 20 ins. diam., with scribing "1/4 S2" visible on cut section of trunk near stump.

III. Set by distance-distance intersect from original bearing trees, a 30 in. long, 2 1/2 in. diam. alum. pipe with a 3 1/4 ins. diam. alum. cap, 23 ins. in the ground, mkd:




Established 2 new bearing trees:

A larch, 5 ins. diam., bears S2°E, 16.5 ft. dist., mkd. "1/4 S1 BT". A pine, 7 ins. diam., bears N50°W, 21.0 ft. dist., mkd. "1/4 S2 BT".

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs. Set a steel guard post North, 3.0 ft. dist., with Land Survey Monument decal.

Magnetic Declination: 20° East.

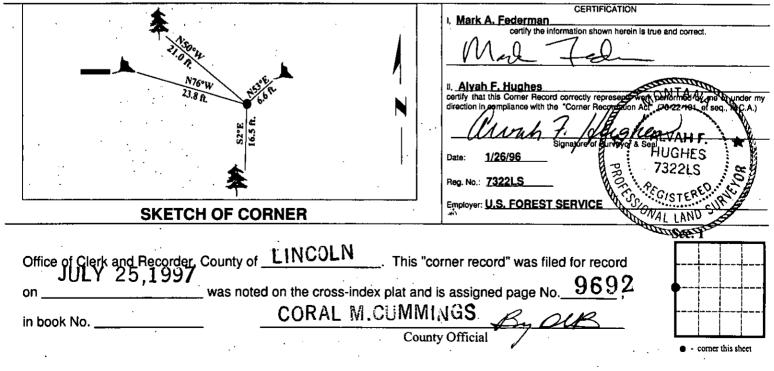

Cross Index No.

C-21

т. 36N

R. 31W