CERTIFIED CORNER RECORDATION


Corner 1/4&C.OE. Sec. 19&20 T. 37N R. 27W P.M., MT Lincoln County 5601/1-2

I. <u>1893 G.L.O. Original Record by Peter McCardell et. al.:</u> Set a post, 3 ft. long, 3 ins. square, 24 ins. in the ground, for 1/4 sec. cor. mkd. "1/4 S" on W. face. Established two bearing trees.

1968 Certified Corner Recordation by Lawrence A. Signani Registration No. 11422: Found a 4 in. tile pipe, (no record found), for 1/4 corner, witnessed by one original bearing tree. Established one new bearing tree.

1970 Corp of Engineers Libby Dam Lake Koocanusa Cadastral District file No. E-53-1-154: Set a standard U.S.C.E. disk mkd. as shown.

II. Found a 2 in. diam. iron pipe, firmly set, protruding 6 ins. above the ground, with a 2 1/2 in. diam. brass cap mkd. as shown below:

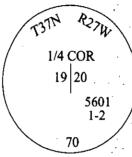

from which:

A pine, 11 ins. diam., bears N50°W, 9.0 ft. dist., mkd. "FS/RM". (1968-record)

A pine stump, 14 ins. diam., bears N86°W, 64.5 ft. dist., no visible scribe. (G.L.O.-record)


A pine stump, 22 ins. diam., bears S75°E, 30.7 ft. dist. (G.L.O.-record)

III. Established one new bearing tree:

A pine, 9 ins. diam., bears S27°E, 6.9 ft. dist., mkd. "1/4 S20 BT".

A 6 in. diam. x 5 ft. tall, round treated fence post, located North, 3.5 ft. dist. to side center. Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East.

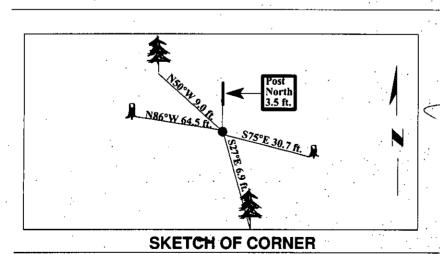

i, Mark Federman

certify the information sflown herein is true-and correct.

i, Ronald A, Pearson

certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Att" (70-22-101, et seq., M.C.A.)

Signature of Surveyor & Seal

Date: 04/17/97

Reg. No.: 9008LS

Employer: U.S. FOREST SERVICE

Sec. 20		
L L		
- corn	er this sheet	

Cross Index No

P-5 C.O.E. 5601/1-2 37N

27W P.M., MT