
## **CERTIFIED CORNER RECORDATION**

Corner W 1/16 Secs. 23 & 26 T. 37N R. 28W P.M., MT Lincoln County

I. <u>1983 Certified Corner Recordation by Carl R. McMillen, LS 4659S</u>: This corner was not previously set. Set driveable aluminum monument in rock cairn, (5/8" x 24" Alum. Mon. w/3" cap).

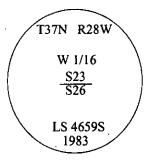

Scribed 2 B.T.'s:

A 9" Tamarack, bears N85°E, 11.40 ft., mkd. "W1/16 S23 BT".

A 5" Red Fir, bears S44°W, 25.30 ft., mkd. "W1/16 S26 BT".

II. Found a 3/4 in. diam. aluminum rod, protruding 6 ins. above the ground, firmly set, with a 3 1/4 in. diam. aluminum cap, mkd. as shown. Monument set in a mound of stone.

from which:

A fir, 7 ins. diam., bears S44°W, 25.3 ft. dist., with a healed face. Larch at N85°E has been removed for field.

III. Established one new bearing tree:

A fir, 8 ins. diam., bearing S85°W, 40.6 ft. dist., mkd. "W1/16 S26 BT". No trees available in sec. 23.

\*Reference: Monument falls near a fence corner, fence runs West and South.

Painted red bands around the bearing tree and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 20° East.

